

Innovations in Water Monitoring

Operator's Manual

Aqua TROLL[®] 600 Multiparameter Sonde

Part Number 0096400



Copyright © 2016 by In-Situ All rights reserved.

This document contains proprietary information which is protected by copyright. No part of this document may be photocopied, reproduced, or translated to another language without the prior written consent of In-Situ

Mailing and Shipping Address:	Phone:	970-498-1500 (international & domestic)
In-Situ	Fax:	970-498-1598
221 East Lincoln Avenue Fort Collins, CO 80524	Internet:	www.in-situ.com
U.S.A.	Support:	800-446-7488 (U.S.A. & Canada)

In-Situ makes no warranty of any kind with regard to this material, including, but not limited to, its fitness for a particular application. In-Situ will not be liable for errors contained herein or for incidental or consequential damages in connection with the furnishing, performance, or use of this material.

In no event shall In-Situ Inc. be liable for any claim for direct, incidental, or consequential damages arising out of, or in connection with, the sale, manufacture, delivery, or use of any product.

In-Situ and the In-Situ logo, Win-Situ, TROLL, Baro Merge, BaroTROLL, HERMIT, HydroVu[™], iSitu, Pocket-Situ, RDO, RuggedCable, RuggedReader, SmarTROLL[™], TROLL, VuSitu[™], and Win-Situ are trademarks or registered trademarks of In-Situ Inc. Microsoft and Windows are registered trademarks of Microsoft Corporation. Pentium is a registered trademark of Intel. Tefzel and Delrin are registered trademarks of E. I. DuPont de Nemours and Company. Viton is a registered trademark of DuPont Dow Elastomers. Kellems is a registered trademark of Hubbell Inc. Alconox is a registered trademark of Alconox Company. Lime-A-Way is a registered trademark of Reckitt Benckiser. Android is a trademark of Google Inc. iPod and iPhone are trademarks of Apple Inc., registered in the U.S. and other countries. The Bluetooth word mark and logos are registered trademarks owned by the Bluetooth SIG, Inc. and any use of such marks by In-Situ Inc. is under license. NIST is a registered trademark of the National Institute of Standards and Technology, U.S.A. Other brand names and trademarks are property of their respective owners.





0096402 | Rev. 002

The presence of the Waste Electrical and Electronic Equipment (WEEE) marking on the product indicates that the device is not to be disposed via the municipal waste collection system of any member state of the European Union.

For products under the requirement of WEEE directive, please contact your distributor or local In-Situ office for the proper decontamination information and take back program, which will facilitate the proper collection, treatment, recovery, recycling, and safe disposal of the device.

Table of Contents

1	Introduction	10
	Serial Number Location	10
	Instrument Description	10
	Document Conventions	10
	Unpacking and Inspection	
	Obtaining Repair Service	11
	Guidelines for Cleaning Returned Equipment	11
	Decontamination and Cleaning Form	13
	Safety	
2	General Specifications	14
	Instrument Dimensions with Restrictor On	16
	Instrument Dimensions with Restrictor Off	16
3	Sensor Specifications	16
	Sensor Summary	
	Barometric Pressure Sensor Specifications	17
	Conductivity Sensor Specifications	17
	Total Dissolved Solids	
	Salinity	18
	Dissolved Oxygen RDO Sensor Specifications	18
	Level, Depth, Pressure Sensor Specifications	19
	ORP Sensor Specifications	20
	pH Sensor Specifications	20
	Temperature Sensor Specifications	20
	Turbidity Sensor Specifications	21
	Total Suspended Solids	21
4	Instrument Overview	22
	Synopsis	22
	System Components	23
	Base Unit Components	23
	Accessories purchased separately.	23
	RuggedCable System	25
	Vented or Non-Vented Cable	25
	Jacket Options	
	Customizable Cable Lengths	25
	Cable Termination	25
5	Instrument Setup	27

	Box Contents	27
	Install the Batteries	28
	Desiccant	29
	Replace the Desiccant	29
	Install the Wiper Motor and Sensors	29
	Removing Sensors	31
6	Connecting to the Sonde	32
	Connecting RuggedCable	32
	Connect the Instrument to the RuggedCable	32
	Connect TROLL Com Communication Device to the RuggedCable System .	32
	Connecting with Bluetooth	33
	Connecting to a Wireless TROLL Com	33
	SDI-12 3 Wire	34
	Modbus Master	36
	Modbus Master with RS232 (Converter Required)	37
7	LCD Screen	37
	LCD Screen	37
	Turn on the LCD Screen	38
	Status Icons	38
	Additional LCD Icons	39
	Full-Text Messages	39
	Sonde Menus	40
	Accessing the Sonde Menus	40
	Data Log Menu	40
	Start a Log	40
	Stop a Log	41
	Contrast Menu	41
	Language Menu	41
	Updates Menu	41
8	Batteries	41
	Battery Replacement	42
9	Micro SD Card	42
	Removing the Micro SD Card	42
	Downloading and Deleting Data from the Micro SD Card	42
	Updating Firmware	43
10	Desiccant	43
	Replace the Desiccant	43
11	Sensor Calibration	44

	Preparing the Aqua TROLL 600 for Calibration	44
	Calibration Recommendations	44
	Factory Calibration	45
12	Software	
13	VuSitu Mobile App	46
	Verify the VuSitu Mobile App Version	46
	Connecting with Bluetooth	46
	VuSitu Overview	48
	About VuSitu	48
	VuSitu Menu Options	48
	Menu Options when Connected to Instrument	48
	Live Readings Screen	
	Changing Parameters and Units	51
	Record Data	51
	VuSitu Locations	52
	About VuSitu Locations	52
	Create a New Location	53
	Select a Location	54
	Edit or Delete a Location	55
	VuSitu Data	56
	About Data	56
	View, Send, Delete Data	56
	VuSitu Calibration & Settings	57
	About Calibration and Settings	57
	Quick-Cal Multiple Sensor Calibration	57
	Calibrate the Rugged Dissolved Oxygen Sensor (1-Point)	59
	100% Water-saturated Air Calibration	59
	Calibrate the Rugged Dissolved Oxygen Sensor (2-Point)	60
	100% Water-saturated Air Calibration	60
	0-point Calibration	61
	Calibrating the Rugged Dissolved Oxygen Sensor Using Concentration	61
	RDO Salinity Setting	62
	Calibrate the Conductivity Sensor	64
	Calibrate the Level Sensor	66
	Calibrate the pH Sensor	66
	Calibrate the ORP Sensor	67
	Calibrate the Turbidity Sensor	69
14	Win-Situ 5	70

Verify the Win-Situ Software Version	70
Win-Situ 5 Screens and Buttons	70
Data Tab	70
Home Tab	72
Logging Tab	74
Sensors Tab	76
Device Setup Tab	77
Win-Situ 5 Logging and Viewing Data	79
About Sites	
Logging Data–Overview	
Logging Method Descriptions	
Logging Methods for Long-Term Monitoring	
Linear	
Linear Average	
Event	81
Log Setup	81
Starting a Log	
Starting a Pending Log	
Starting a Manual Log	
Suspending (Pausing) a Log	82
Resuming a Suspended Log	82
Stopping a Log	82
Restarting a Log	83
Downloading Data to a PC	
Viewing Logged Data	
Exporting Data	84
Exporting Data to Spreadsheet Format	
Exporting to Text	
Graphing Data	
View a Graph of a Downloaded File	
View a Graph of Real-Time Data	
Graph Settings	
Graph Templates	
Graph Tools	
Calibration	
Calibrate Sensors	
Calibrating the Conductivity Sensor	
Calibrating the Pressure Sensor	

Calibrating the RDO Sensor	
Calibrate 100% Oxygen Saturation	91
Calibrate 0% Oxygen Saturation	
Calibrating the pH/ORP Sensor	
Calibrating the Turbidity Sensor	94
Calibration Reports	
Saving Calibration Reports	96
Viewing Calibration Reports	
BaroMerge	
Using BaroMerge Software	96
Baro Merge Input–Manual Entry	97
Baro Merge Input–Fixed Correction	
BaroMerge Input–BaroTROLL File	
BaroMerge Output	100
Post Level Correction within Baro Merge	
Managing Data from Multiple Sites	101
Adding a Site	
Editing a Site	101
Deleting a Site	101
Using Site Groups	101
Creating a Site Group	102
Site-Based Connections	
Creating a Custom Connection	102
Using a Custom Connection	102
Storing Custom Connection for a Site	
Correcting a Level Reference in Data Files	103
About Post Correcting Level Data	103
Open Post Level Correction	103
Select Level Reference Type	
Set the Level Correction	
View Post Level Corrected Data	
Win-Situ 5 Troubleshooting	106
Selecting the Correct COM Port	
Bluetooth Connection	107
Water Quality	
рН	
What is pH?	108
Why Measure pH?	

15

	The pH/ORP Sensor	109
	Oxidation-Reduction Potential	110
	What is ORP?	110
	Why Measure ORP?	
	The pH/ORP Sensor	111
	Conductivity	111
	What is Conductivity?	111
	Why Measure Conductivity?	112
	How is Conductivity Measured?	112
	Dissolved Oxygen	113
	What is Dissolved Oxygen?	113
	Why Measure DO?	113
	How is DO Measured?	113
	Turbidity	114
	What is Turbidity?	114
	Why Measure Turbidity?	114
	How is Turbidity Measured?	115
16	Care and Maintenance	117
	Maintenance Schedule	117
	User-Serviceable Parts	117
	O-rings	117
	pH/ORP Sensor Replacement	117
	RDO Sensor Cap Replacement	117
	Instrument Storage	117
	Short-term Storage (<1 Week)	117
	Long-term Storage (>1 Week)	117
	Cleaning the Sonde	118
	Cleaning and Storing the pH/ORP Sensor	
	Routine Maintenance	118
	Replacing the Filling Solution	119
	Replacing the Junction	119
	Cleaning	119
	Short-term Storage	
	Long-term Storage	120
	Storage Recommendations	
	Cleaning and Storing the RDO Sensor	121
	Routine Maintenance	121
	Cleaning the Optical Window	121

	Storage	
	Cleaning and Storing the Conductivity Sensor	121
	Cleaning	
	Storage	
	Cleaning and Storing the Turbidity Sensor	122
	Routine Maintenance	
	Storage	
	Replacing Wiper Bristles	
	Replace the Bristles	123
	Replace the Entire Brush	123
	Cleaning the Copper Antifouling Restrictor	
17	Declaration of Conformity	

Introduction

This manual is intended to describe the characteristics, operation, calibration, and maintenance of the AquaTROLL 600 Multiparameter Sonde.

Serial Number Location

The instrument serial number is on the product label affixed to the instrument body. Serial numbers for individual sensors are engraved on the sensor body.

Instrument Description

The Aqua TROLL 600 Sonde is a multiparameter water quality sonde with LCD screen, internal memory, and additional SD card storage. The Aqua TROLL 600 uses the latest sensor and electronics technology to provide laboratory-quality measurements for field use. The water level/pressure sensor and barometric pressure sensor are integrated into the sonde. The optical Rugged Dissolved Oxygen (RDO[®]), conductivity, temperature, turbidity, pH/ORP sensors and the RDO Sensor Cap are replaceable. It is optional to include a motorized sensor wiper on the instrument.

The Aqua TROLL 600 can connect wirelessly via Bluetooth to the VuSitu Mobile App or can connect to Win-Situ 5 Software using cable or Bluetooth.

Document Conventions

Throughout this document you will see the following symbols:

A check mark highlights a tip or feature.

The exclamation point calls your attention to a requirement, safety issue, or important action that should not be overlooked.

Unpacking and Inspection

Your equipment was carefully inspected before shipping. Check the equipment for any physical damage sustained during shipment. Notify In-Situ and file a claim with the carrier if there is any such damage; do not attempt to deploy or operate the instrument.

Save packing materials for future storage and shipping of your equipment.

Accessories may be shipped separately and should also be inspected for physical damage and fulfillment of your order.

Obtaining Repair Service

If you suspect your system is malfunctioning and repair is needed, you can help assure efficient servicing by following these guidelines:

- 1. Call or email In-Situ Technical Support. Have the product model and serial number available.
- 2. Be prepared to describe the problem, including how the product was used and the conditions noted at the time of the malfunction.
- If Technical Support determines that service is needed, they will ask your company to fill out the RMA form and pre-approve a specified monetary amount for repair charges. When the form and pre-approval is received, Technical Support will assign an RMA (Return Material Authorization) number.
- 4. Clean the product as described in the manual.
- 5. If the product contains a removable battery, remove and retain it unless you are returning the system for a refund or Technical Support states otherwise.
- 6. Carefully pack your product in its original shipping box, if possible.
- 7. Mark the RMA number clearly on the outside of the box.
- 8. Send the package, shipping prepaid, to:

In-Situ ATTN: Repairs 221 East Lincoln Avenue Fort Collins, CO 80524

The warranty does not cover damage during transit. In-Situ recommends insurance for all shipments. Warranty repairs will be shipped back prepaid.

Outside the U.S.

Contact your international In-Situ distributor for repair and service information.

Guidelines for Cleaning Returned Equipment

Please help us protect the health and safety of our employees by cleaning and decontaminating equipment that has been subjected to potential biological or health hazards, and labeling such equipment. Unfortunately, we cannot service your equipment without such notification. Please complete and sign the form on page 13 (or a similar statement certifying that the equipment has been cleaned and decontaminated) and send it to us with each instrument.

- We recommend the glassware cleaning product, Alconox, available from In-Situ and from laboratory supply companies.
- Clean all cables and remove all foreign matter.

- Clean the cable connectors with a clean, dry cloth. Do not submerge the connectors.
- Clean the instrument including the nosecone, cable head, and protective caps.

If an instrument is returned to our Service Center for repair or recalibration without a statement that it has been cleaned and decontaminated, or if it is the opinion of our Service Representatives that the equipment presents a potential health or biological hazard, we reserve the right to withhold service until proper certification is obtained.

Decontamination & Cleaning Statement

Company Name		Pho	one
Address			
City	State		_ Zip
Instrument Type	Serial Number		
Contaminant(s) (if known)			
Decontamination procedure(s) used			
Cleaning verified by		Title	
Date			🕸 In-Situ Inc.

Safety

- Use D-cell alkaline batteries.
- Do not use batteries of different ages or types.
- Do not submerge the Wireless TROLL Com or your mobile device in liquid.
- Ensure that sensors, or sensor plugs, are completely inserted into the ports, so that no liquid can enter the instrument.
- Ensure that the RDO Sensor Cap is pressed firmly over the sensor lens and is flush with the instrument before submerging in liquid.
- Replace the cable if insulation or connectors are damaged.
- Make sure the probe and sensor O-rings are clean and free of damage.

General Specifications

Operating temperature	-5 to 50° C (23 to 122° F)
Storage temperature	Components without fluid: -40 to 65° C (-40 to 149° F) pH/ORP probes: -5 to 65° C
Dimensions	4.7 cm (1.85 in.) OD x 59.2 cm (23.3 in.) with restrictor installed (including connector) With bail: 72.9 cm (28.7 in.)
Weight	1.45 kg (3.2 lbs) - includes all sensors, batteries, bail
Wetted materials (sonde and sensors)	Ceramic, Delrin™, Inconel™, PC, PC alloy, Platinum, Nylon, Santoprene™,Titanium, Viton™
Environmental rating	IP68 with all sensors and cable attached. IP67 with sensors removed, battery cover removed, or cable detached
Max pressure rating	Up to 350 PSI
Communication	RS485/MODBUS, SDI-12, Bluetooth®
Reading rate	1 reading every 2 seconds for one parameter, no wipe
Internal memory ¹	16 MB
Additional memory, micro SD card ²	8 GB included, any size micro SD accepted
Logging rate	1 minute to 99 hours
Logging modes	Linear, Linear Average, Event
Data logging	50 logs (defined, scheduled to run, or stored)
LCD screen	Integrated display shows status of sonde, sensor ports, data log, battery, and connectivity
Internal power Battery life ³	 (2) user-replaceable D-cell alkaline batteries >6 months typical with wiping >9 months typical without wiping
External power voltage ⁴ External power current ⁴	8-36 VDC, 275 mA maximum (not required) Sleep: 0.10 mA typical Measurement: 15 mA typical, 45 mA maximum
Interface	Win-Situ 5 Software, VuSitu Mobile App on select mobile devices using Android 4.4 with Bluetooth 2.0

Cable	Vented or non-vented polyurethane or vented Tefzel ${ m I\!R}$
Hex screw driver	0.050 in. (1.3 mm)
Software Interface	Android: VuSitu available on the Google Play Store (Android 4.4 or above, requires Bluetooth 2.0) Windows: Win-Situ 5 Data Services: HydroVu
Certifications	CE, FCC, WEEE, RoHS compliant
	2 year - sonde, sensors (excluding pH/ORP);
Warranty	1 year - pH/ORP sensor
	Other - see warranty policy at <i>www.in-situ.com</i>
Notes	Specifications are subject to change without notice. Android is a trademark of Google, Inc. Bluetooth is a trademark of Bluetooth SIG, Inc. Delrin and Tefzel are trademarks of E.I. du Pont de Nemours & Co. Santoprene is a trademark of ExxonMobile. Inconel is a trademark of Special Metals Corporation. Viton is a registered trademark of DuPont Performance Elastomers L.L.C.


¹For 30 parameters>100,000 data records, > 3 years at 15 minute interval. A single data record includes timestamp, temperature, RDO, pH, ORP, turbidity, and conductivity logged in Linear or Linear Average mode.

²Log data recorded to SD card in comma delimited variable (CSV) file format.

³Logging all sensors at 15 minute interval on 2 D-cell alkaline batteries. Battery life dependent on site conditions and wiping.


⁴Dependent on display and wiping

Instrument Dimensions with Restrictor On



Total length with connector	59.16 cm (23.29 in.)
Diameter	47 mm (1.85 in.)

Instrument Dimensions with Restrictor Off

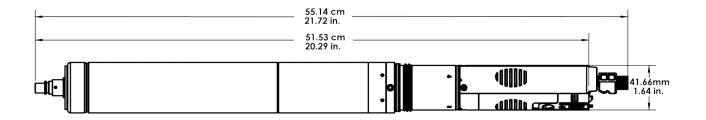

Total length with wiper brush on	55.14 cm (21.72 in.)
Total length with wiper brush off	51.53 cm (20.29 in.)
Diameter	41.66 mm (1.64 in.)

Sensor Specifications

Sensor Summary

Sensors	Shelf Life	Field Life*	Recommended Calibration Frequency*	Pressure Rating - PSI		ble pth s Feet	Temperature Range
pH/ORP	15 months	1 year or greater	10 to 12 weeks	350	246	807	- 5 to 50° C
RDO	NA	2 years or greater	12 months	350	246	807	- 5 to 50° C

Conductivity	NA	2 years or greater	User calibration only if needed	350	246	807	- 5 to 50° C
Temperature	NA	2 years or greater	NA	350	246	807	- 5 to 50° C
Turbidity	NA	2 years or greater	User calibration only if needed	350	246	807	- 5 to 50° C
Pressure	NA	2 years or greater	User calibration only if needed	12.8 42.7 108 285	9 30 76 200	30 100 250 650	- 5 to 50° C
Barometric Pressure	NA	2 years or greater	User calibration only if needed	NA	NA	NA	- 5 to 50° C

* Field life and calibration frequency dependent on site conditions.

See the Aqua TROLL 600 specification sheet for sensor specifications.

Barometric Pressure Sensor Specifications

Accuracy	±1.0 mbar
Range	300 to 1,100 mbar
Resolution	0.1 mbar
Sensor Type	Fixed
Response Time	T63<1s, T90<1s, T95<1s
Units of Measure	psi, kPa, bar, mbar, mmHg, inHg
Methodology	Silicon strain gauge

Conductivity Sensor Specifications

.

Accuracy*	±0.5% of reading plus 1 μS/cm from 0 to 100,000 μS/cm; ±1.0% of reading from 100,000 to 200,000 μS/cm
Range	0 to 350,000 μS/cm
Resolution	0.1 μS/cm
Sensor Type	Removeable

Response Time	T63<1s, T90<3s, T95<5s
Units of Measure	Actual conductivity: μS/cm, mS/cm Specific conductivity: μS/cm, mS/cm Salinity: PSU Total dissolved solids: ppt, ppm Resistivity: Ohms-cm Density: g/cm3
Methodology	Std. Methods 2510, EPA 120.1

*Accuracy at calibration points.

Total Dissolved Solids

TDS is derived from conductivity and temperature.

Range	0 to 350 ppt
Resolution	0.1 ppt
Units of Measure	ppt, ppm

Salinity

TDS is derived from conductivity and temperature.

Range	0 to 350 PSU
Resolution	0.1 PSU
Units of Measure	PSU
Methodology	Std. Methods 2520A

Dissolved Oxygen RDO Sensor Specifications

ı.

Accuracy	±0.1 mg/L from 0 to 8 mg/L ±0.2 mg/L from 8 to 20 mg/L ±10% of reading from 20 to 50 mg/L
Range	0 to 8 mg/L 8 to 20 mg/L 20 to 50 mg/L Full operating range: 0 to 50 mg/L; 0 to 500% saturation
Resolution	0.01 mg/L
Sensor Type	Removable with replaceable RDO-X Cap

	Response Time	RDO-X Cap: T63<15s, T90<45s, T95<60s
_	Units of Measure	mg/L, % saturation, ppm
-	Methodology	EPA-approved In-Situ Methods (under the Alternate Test Procedure process): 1002-8-2009, 1003-8-2009, 1004-8- 2009

Level, Depth, Pressure Sensor Specifications

Accuracy	Typical ±0.1% full scale (FS)
Range	Non-vented or Vented 9.0 m (30 ft) - Burst: 27 m (90 ft) 30 m (100 ft) - Burst: 40 m (130 ft) 76 m (250 ft) - Burst: 107 m (350 ft) 200 m (650 ft) - Burst: 229 m (750 ft)
Resolution	±0.01% FS or better
Sensor Type	Fixed
Response Time	T63<1s, T90<1s, T95<1s
Units of Measure	Pressure: psi, kPa, bar, mbar, mmHg, inHg, cmH ₂ O, inH ₂ O Level: mm, cm, m, in, ft, cmH ₂ O, inH ₂ O
Methodology	Piezoresistive; ceramic

*Typical performance across full temperature and pressure calibrated range.

ORP Sensor Specifications

Accuracy*	±5.0 mV @ 25° C
Range	±1,400 mV
Resolution	0.1 mV
Sensor Type	Replaceable pH/ORP combo sensor
Response Time**	T63<3s, T90<15s, T95<30s
Units of Measure	mV
Methodology	Std. Methods 2580

*Accuracy from standard at 25° C. **At thermal equilibrium immediately following calibration, measuring from air to +400 mV

pH Sensor Specifications

Accuracy	±0.1 pH units or better
Range	0 to 14 pH units
Resolution	0.01 pH unit
Sensor Type	Replaceable pH/ORP combo sensor
Response Time*	T63<1s, T90<2s, T95<3s
Units of Measure	pH units
Methodology	Std. Methods 4500-H+, EPA 150.2

*At thermal equilibrium.

Temperature Sensor Specifications

Accuracy	±0.1° C
Range	-5 to 50° C (23 to 122° F)
Resolution	0.01° C
Sensor Type	Replaceable
Response Time	T63<2s, T90<15s, T95<30s

Units of Measure	°C, °F
Methodology	EPA 170.1

Sensor only, when transferring from air to ambient water temperature. Typical system response time with all sensors and restrictor installed: T63<30s; T90<3.5m; T95,7.5m

Turbidity Sensor Specifications

Accuracy	$\pm 2\%$ of reading or ± 2 NTU or FNU, whichever is greater
Range	0 to 4,000 NTU
Resolution	0.01 NTU (0 to 1,000 NTU) 0.1 NTU (1,000 to 4,000 NTU)
Sensor Type	Replaceable
Response Time	T63<1s, T90<1s, T95<1s
Units of Measure	NTU, FNU
Methodology	ISO 7027

Total Suspended Solids

TSS is derived from turbidity.

Range	0 to 1,500 mg/L
Resolution	0.1 mg/L
Units of Measure	ppt, mg/L

User-defined reference.

Instrument Overview

Synopsis

The Agua TROLL® 600 is a portable, intelligent water guality data logging instrument built to measure and store water level (pressure), temperature, barometric pressure, and water quality data for many applications under many environmental conditions, including marine waters. The instrument's outside diameter (OD) allows the instrument to conform to a 2-in./5.08 cm diameter (or larger) well. The Agua TROLL 600 is recommended for applications like ambient long-term water quality monitoring in fresh and marine environments; groundwater guality sampling (e.g., low-flow groundwater sampling, groundwater guality monitoring); mine water monitoring; stormwater management; vertical profiling; horizontal transect; and other environmental applications in normal and extreme environmental conditions. The housing and sensing materials allow it to be used in various environments from fresh water to saltwater. The instrument's LCD screen provides clear, instant visual indicators of overall readiness, battery life, internal log, sensor status, and connectivity. It is easily programmed through the VuSitu[™] Mobile Application available for Android[™] devices (Android 4.4, requires *Bluetooth*® 2.0) or Win-Situ® 5 for Windows®. Users can email data from an Android device via the VuSitu Mobile App; log data to a smartphone; or download data directly to a computer via smartphone connection; tag sites with GPS coordinates; and keep track of sites with photos and descriptions. Data can also be downloaded via an internal, removable micro SD card. Calibrations are simplified through auto-detection of calibration solutions and auto-stabilization. The instrument can be deployed using In-Situ's RuggedCable System, and with In-Situ's Tube/Cube Telemetry Systems and HydroVu[™] Data Services for real-time data access anywhere there is an internet connection.

System Components

Base Unit Components

Component	Part Number
RDO Sensor - includes RDO-X Cap	0063450
Combination pH/ORP Sensor	0063470
Turbidity Sensor	0063480
Combination Conductivity/Temperature Sensor or standalone Temperature Sensor	0063460, 0063490
8 GB Micro SD Card	0078950
Alkaline Batteries (2)	0042020
Dual Stainless Steel Restrictor/Storage Chamber	0079820
Calibration Cup	0079870
Sensor Port Plugs (2)	0063510
Rubber Bumpers (2)	0079880
Wiper or Wiper Port Plug	0063500, 0064630

Accessories purchased separately.

Communications		
Wireless TROLL Com for Android	0031240	
Mobile Device for Android	0064860	
TROLL Com RS-232 Cable Connect	0056140	
TROLL Com USB Cable Connect	0052500	
TROLL Com RS-232 Direct Connect	0056150	
TROLL Com USB Direct Connect	0052510	

Cable	
Stripped-and-tinned Cable with male connector	0053310
Twist-Lock Bulkhead Connector	0053240
Twist-Lock Backshell / Hanger, Titanium	0051480
Cable Extender	0051490
Large Desiccant (titanium connector)	0051810
Large Desiccant (ABS connector)	0053550
Small Desiccant (3 pack) - storage desiccant	0052230

Cable	
Stripped-and-tinned Cable with male connector	0053310
Twist-Lock Bulkhead Connector	0053240
Twist-Lock Backshell / Hanger, Titanium	0051480
Cable Extender	0051490
Large Desiccant (titanium connector)	0051810
Large Desiccant (ABS connector)	0053550
Desiccant Refill Kit for Large or Outboard Desiccant	0029140

Calibration and Maintenance	
RDO Classic Cap Replacement Kit	0079790
pH/ORP Replacement Reference Junction Kit	0078990
Wiper Brush Kit	0079810
Maintenance Kit	0078940
Copper Antifouling Guard	0076100
Quick-Cal Solution for calibrating DO, Cond., pH & ORP	0033250
Dissolved Oxygen Calibration Kit	0032110
D.O. Field Calibration Kit	0080830
Conductivity Calibration Kit (Full)	0032090
Conductivity Calibration Kit (Low)	0032630
Conductivity Calibration Kit (High)	0032640
pH Calibration Kit	0032080
pH/ORP Calibration Kit	0032120
pH Storage Solution	0065370
Individual Calibration Solutions	See website

Low-Flow	
Complete Low-Flow Kit (includes flow cell with fittings and stake, base plate, documentation)	0066820
Flow Cell Kit	0066830
Flow Cell Base Plate	0044430
Fittings Kit	0093480
Pelican Case with foam insert	0066860

RuggedCable System

RuggedCable Systems are custom-built, durable, direct-read cables that include the following items.

- Titanium twist-lock connectors for quick, reliable connections to the instrument, desiccant, and communication cable
- Metal shield beneath the cable jacket to prevent electrical interferences
- Kellems grip for secure instrument deployment
- Small desiccant for vented systems (for storage only)

Non-vented cables are marked with VF, which means vent free.

Vented or Non-Vented Cable

Vented cable is used with vented pressure sensors to produce gauged measurements. The cable vent tube ensures that atmospheric pressure is applied to the back of the sensor diaphragm.

Non-vented cable is used with non-vented instruments for absolute measurements. Compensate absolute measurements by using a BaroTROLL Instrument and Win-Situ Baro Merge Software.



Vented cable is shipped with a small desiccant to protect against condensation. Larger desiccants are necessary for deployment.

Jacket Options

Tefzel (vented) or thermoplastic polyurethane (TPU, vented or non-vented)

Customizable Cable Lengths

Cables can be ordered up to 1,219 m (4,000 ft).

Cable Termination

Cables can be ordered with a twist-lock termination (female connector) on both ends that connect to the instrument, the TROLL Com Communication Device, desiccant, and other accessories.

Cables can also be ordered with stripped-and-tinned termination for wiring to a data logger or controller using SDI-12, analog (4-20 mA), or Modbus communication protocol.



1	RuggedCable System with female to female connectors
2	Stripped-and-tinned RuggedCable System with female connector
3	Stripped-and-tinned RuggedCable System with male connector (short length that converts a cable with a twist-lock connector to a stripped-and-tinned cable)

Instrument Setup

Box Contents



1	Documentation and software
2	Wiper motor and brush or wiper port plug
3	Aqua TROLL [®] 600 Sonde
4	Water quality sensors (2 of 4)
5	Calibration cup
6	Water quality sensors (2 of 4)
7	RDO sensor cap
8	Accessory supplies*
9	pH/ORP sensor maintenance supplies
10	Extra sensors (0 to 2)

11

D-cell alkaline batteries (2)


12 Instrument tools[†]

* Accessory supplies include wiper screws (2), wiper brush (2), silicone lubricant for Orings (2), battery compartment desiccant, replacement battery compartment hex screw driver, lens cloth, and micro SD card adapter.

† Instrument tools include a 0.050 in./1.3 mm hex screwdriver for sensor screws, a flathead screwdriver for the pH reference junction, and a Phillips head screwdriver for bail screws.

Install the Batteries

1. Twist open the battery compartment, remove the disposable desiccant pack in the battery compartment, and install the batteries.

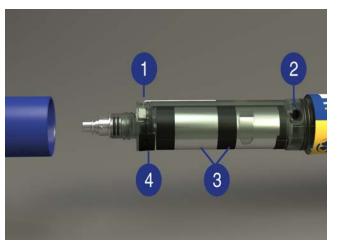

- 1 Allen wrench (backup)
- 2 Replaceable desiccant
- 3 D-cell alkaline batteries
- 4 Micro SD card



Install two alkaline D-cell batteries.

Use only alkaline batteries. Do not use batteries of different ages. For more information on batteries, see "Batteries" on page 41.

- 2. On the opposite side of the batteries is a back-up Allen wrench that can be used for sensor installation and removal.
- 3. Check to see that the replaceable desiccant capsule is blue indicating it is fresh. Replace the desiccant if it is pink.

4. Close the battery compartment. If the batteries are installed correctly the LCD screen will turn on.

Desiccant

The Aqua TROLL 600 contains a small, replaceable desiccant capsule in the battery compartment. This capsule prevents moisture from causing damage to the electronic components. It is filled with color-indicating silica that gradually changes from purple to pink as the desiccant's effectiveness decreases. Replace the desiccant when the desiccant has turned pink. The desiccant is included in the Aqua TROLL 600 Maintenance Kit (0078940).

Replace the Desiccant

- 1. Remove the battery cover.
- 2. Remove the backup wrench tool from the back of the battery compartment.
- 3. Insert the backup wrench into the small hole on the back side of the battery compartment and push the desiccant capsule out.
- 4. Insert a new desiccant capsule and push the capsule in fully using the wrench.

Install the Wiper Motor and Sensors


- 1. Remove the restrictor.
- 2. Remove the protective sticker from the end of the sonde to expose the sensor ports.




Rubber bumpers are included on the ends of the sonde to help prevent the sonde from rolling off working surfaces. You can deploy the sonde with or without these safeguards.

3. Locate the cylindrical wiper motor (or motor port plug) and remove the dust cap. Apply a small amount of lubricant from the maintenance supplies to the O-rings. Align the pins and push the motor (or plug) firmly into the center port.





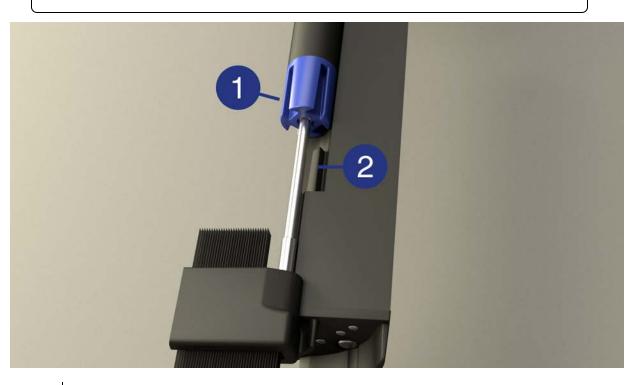

- 1 Sensor interlock grooves
- 2 Sensor interlock tab



The pH/ORP sensor is shipped with a storage cap taped on the sensor. Remove this cap before installation and save the cap for later storage.

Salt crystals may form on pH/ORP sensors during storage. These

crystals are normal and do not impact sensor performance.

When installing an RDO sensor, install the RDO Cap before installing the sensor body on to the sonde. Do not touch or rub the cap face. Make sure the RDO cap is seated firmly and the tab is locked in place.

4. Locate the conductivity sensor. Remove the dust cap and apply lubricant to the conductivity sensor O-rings. Install the sensor into port 1 making sure the sensor tongue slides into the blue motor interlock groove.



Sensors can be installed in any port, however, installing the conductivity sensor in port 1 allows for the most efficient energy consumption.

- 5. Install the remaining sensors, applying lube to all O-rings. Sensors should be seated tightly together with no gaps between connecting edges or the instrument base.
- 6. When all sensors are installed, use the Allen wrench to tighten the screw at the base of each sensor. Do not overtighten the screws.
- 7. Place the metal restrictor over the sensors and twist into place. Ensure that the vent holes are located at the base of the instrument to allow sufficient flow to the sensors.



Note: The restrictor can be inverted to act as a storage cup when the instrument is not in use. See "Instrument Storage" on page 117.



Removing Sensors

- 1. Loosen the sensor screw.
- 2. Insert the Allen wrench into the small hole at the base of the sensor.

3. Push the wrench body towards the sensor so the inserted tip of the wrench rotates towards the sonde body.



4. Pull the sensor out of the port.

Connecting to the Sonde

Connecting RuggedCable

Connect the Instrument to the RuggedCable

- 1. Remove the protective caps from the instrument and cable. Ensure that the O-ring on the instrument connector is clean. Apply a small amount of vacuum grease to the o-ring.
- 2. Position the instrument and cable flat edges so they will connect properly. Insert the instrument connector firmly into the cable connector.



3. Hold the textured section of the sleeve in one hand and the instrument in the other. Push and twist until you hear a click. The click ensures the cable and instrument are securely attached.



Connect TROLL Com Communication Device to the RuggedCable System

- 1. If a desiccant is present, remove the desiccant from the cable. Twist the desiccant and cable sleeve in opposite directions to unlock the desiccant from the cable.
- 2. Position the TROLL Com and cable flat edges so they will connect properly. Push and twist until you hear a click.

Connecting with Bluetooth

The Aqua TROLL 600 can connect to a Bluetooth-enabled device for wireless communication with the VuSitu Mobile App or Win-Situ 5.

- 1. Turn on the Aqua TROLL 600 LCD screen by holding the sonde vertical with the sensor end facing up.
- 2. On the Bluetooth-enabled device, navigate to the Bluetooth menu and scan for available devices.
- The Aqua TROLL 600 will be listed as "Serial Number AT600". For example, 424690 - AT600. Tap the device name to pair the Aqua TROLL 600 and the Bluetooth-enabled device.

Connecting to VuSitu

1. Open the VuSitu Mobile App. If you have correctly paired your Aqua TROLL 600 with your wireless device, and the instrument is available, the software will connect and display readings.



If the Searching screen continues to show, tap Choose another device and select the device you are trying to connect to.

Connecting to Win-Situ 5

- 1. Open Win-Situ 5 Software.
- 2. When prompted, "Connect to device now?" click No.
- 3. Click Preferences, then click Comm Settings.
- 4. Select the correct Com port used by Bluetooth, then select the following settings:
 - Baud: 19200
 - Data Bits: 8
 - Parity Bits: None
 - Stop Bits: 1
 - Device Address: 1
 - Mode: Modbus-ASCII
- 5. Click the checkmark, then click the Connect button in the lower right hand corner.

Connecting to a Wireless TROLL Com

A Wireless TROLL Com can be used to connect the instrument to software if the sonde is deployed on a cable.

- 1. Turn on the Wireless TROLL Com.
- 2. Make sure the cable is connected to the instrument as well as the communication device.
- 3. Go to Bluetooth settings on your mobile device or computer.
- 4. From the Bluetooth section, search for devices.
- 5. Tap or click the serial number of the communication device to pair the device with the phone or computer. The serial number is located under the USB flap.

Connecting to VuSitu

1. Open the VuSitu Mobile App. If you have correctly paired your Wireless TROLL Com with your wireless device, and the instrument is available, the software will connect and display readings.



If the Searching screen continues to show, tap "Choose another device" and select the device you are trying to connect to.


Connecting to Win-Situ 5


- 1. Open Win-Situ 5 Software.
- 2. When prompted, "Connect to device now?" click No.
- 3. Plug the USB charging cable into the computer and Wireless TROLL Com.
- 4. Click Preferences, then click Comm Settings.
- 5. Select the correct Com port used by the charging cable, then select the communication settings for the instrument you are connecting. The following default communication settings are most common for In-Situ instruments:
 - Baud: 19200
 - Data Bits: 8
 - Parity Bits: Even
 - Stop Bits: 1
 - Device Address: 1
 - Mode: Modbus-RTU

If you cannot connect using these settings, click the "Search for Devices" or "Reset All Devices" button.

6. Click the checkmark, then click the Connect button in the lower right hand corner.


SDI-12 3 Wire

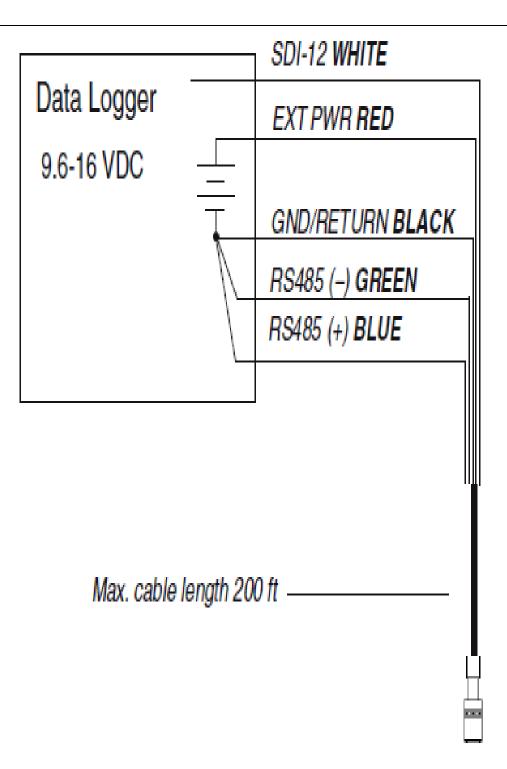

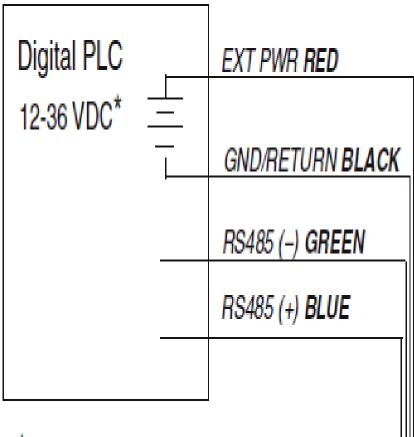

* Optional but highly recommended

Modbus Master with RS232 (Converter Required)

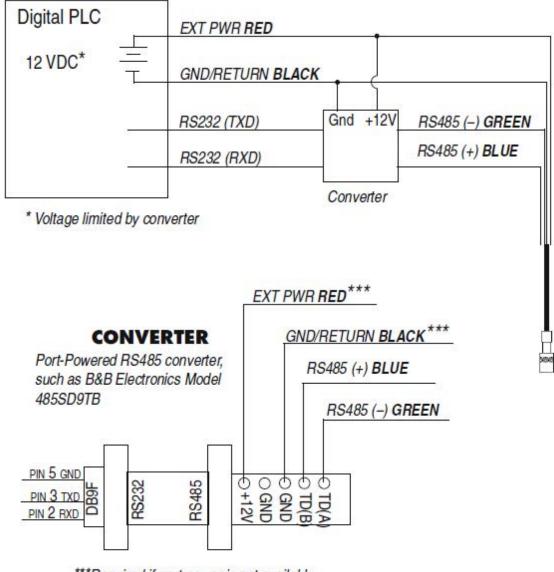

***Required if port power is not available

LCD Screen

١

LCD Screen

The AquaTROLL 600 includes an LCD screen that allows you to view instrument status and access sonde settings.

Turn on the LCD Screen

- 1. Hold the sonde vertically so the sensor end faces up.
- 2. The LCD screen will illuminate after a few seconds briefly displaying the platform name and firmware version, followed by the RDO Sensor Cap expiration information (if applicable).
- 3. The LCD screen will then display port status, power status, log status, and connection status (when applicable).

Below is one example of how the LCD screen will appear when the instrument is ready to be deployed.



1	Port Status
2	Power Status
3	Log Status
4	Connected Status (shown only when connected)

Status Icons

	Possible Port Status		Possible Power Status
	Sensors are installed	Ē	Battery level indicator
	Sensor Port Plugs are installed	Î	External power provided
401 302	Sensor error	1	Battery error or Battery below 10%
41) 312	Ports are open		
	Possible Log Status		Possible Connected Status
►	A log is running	*	Connected to software via Bluetooth

Possible Port Status			Possible Power Status
0	A log is scheduled	- 3 -	Connected to software via cable
1	A log is paused		
	No log is configured		

Additional LCD lcons

Ō	Instrument is working on a task.
•	Three taps on the instrument body allows access to the menu. A single tap selects the highlighted menu item.
e	Tilt the instrument to the left to scroll up through the menu items.
5	Tilt the instrument to the right to scroll down through the menu items.
*	Indicates the top of the menu has been reached.
*	Indicates the bottom of the menu has been reached.
A	Consult the manual.

Full-Text Messages

The LCD will display text messages instead of status icons when certain conditions are met. Multiple messages will rotate and display for 3 seconds each.

Text Message	Cause and Remedy
Close battery cover	Battery cover is not fully closed. Ensure the battery cover is securely tightened.
Install wiper	Wiper sensor port is open. Install wiper or wiper port plug into center port.
Install sensors	Sensor ports are open. Install sensors or sensor port plugs.
Install temperature	No Temperature or Conductivity/Temperature sensor detected. Install a sensor with Temperature.

Text Message	Cause and Remedy
Install RDO Cap	RDO Cap not detected on RDO sensor. Install RDO cap.
RDO Cap expired	RDO cap is no longer valid. Install a new RDO Cap.
RDO Cap XXX days	Temporary text message update on the lifespan of the RDO Cap.

Sonde Menus

Sonde settings are accessed from menus displayed on the LCD screen. Within the sonde menus you can start or stop a simple data log, change the contrast or language settings, and update firmware for the sonde or sensors.

Accessing the Sonde Menus

- 1. Hold the sonde vertically so the sensor end faces up. The LCD screen will illuminate after a few seconds.
- 2. Wait until the LCD screen displays the status icons.
- 3. Hold the sonde horizontally and firmly tap the Aqua TROLL 600 Logo next to the LCD screen 3 times, pausing 1 second between taps.
- 4. The LCD screen will display the Main Menu along with arrow icons.
- 5. Tilt the sonde right or left to scroll through menu options.
- 6. To select a menu option, ensure it is highlighted with a black background and light text and firmly tap the Aqua TROLL 600 logo once.

Data Log Menu

The Data Log menu allows you to create and start a basic linear data log (if none has been set in Win-Situ 5 or VuSitu Software), or stop a log if it is running.

Start a Log

- 1. Access the data log menu.
- 2. Select New.
- 3. Select the desired reading interval. The data log will start once the interval is selected.

The data log will appear in Win-Situ with the Log Name "Aqua TROLL 600 SERIAL NUMBER," where SERIAL NUMBER will be the serial number of the unit. This log records all sensors and parameters and is a no wrap log. This means once the data capacity is reached the log will stop.



You are unable to update the instrument firmware while a log is running. Stop a log to update the sonde or sensors.

Stop a Log

- 1. Access the Data Log menu.
- 2. Select Stop.
- 3. Select **Yes**. The data log will stop.

Contrast Menu

The Contrast Menu allows you to adjust the contrast on the LCD screen.

- 1. Access the Contrast menu.
- 2. Tilt the sonde left to decrease (lighten) the contrast, or right to increase (darken) the contrast.
- 3. Tap the Aqua TROLL 600 logo to set the selected contrast.

Language Menu

The Language Menu allows you to set the default display language of the LCD screen.

- 1. Access the Language menu.
- 2. Highlight the desired language (English, Spanish, French, German).
- 3. Tap the Aqua TROLL 600 logo to set the selected language.

Updates Menu

The Updates Menu allows you to update firmware for the sonde or installed sensors.

- 1. Access the Updates menu.
- 2. Highlight the desired component to update (Sonde, Sensor 1 to 4).

If an update is present on the SD card, the screen will indicate the previous firmware version, a right-facing arrow, and the new version of the firmware.

3. Select **Yes** to update the firmware.

For more information on firmware updates, see "Updating Firmware" on page 43.

Batteries

The Aqua TROLL 600 uses two standard D-cell 1.5 V alkaline batteries.

Battery Replacement

- 1. Open the battery compartment and remove both batteries.
- 2. Insert new batteries. Ensure the LCD screen turns on.
- 3. Replace the battery cover.

Never use lithium batteries, or batteries that are different ages or manufacturers.

In-Situ recommends using new batteries every time.

Micro SD Card

The Aqua TROLL 600 uses a micro SD card for data storage and updating sonde firmware. You can remove the SD card and replace it with another for data download, or use the same card. An SD card is not required to log data.

Removing the Micro SD Card

The micro SD card is housed in a slot near the positive battery terminal and the twistlock connector.

- 1. Remove the battery cover from the end of the instrument.
- 2. Push the micro SD card in towards the instrument to release the card.
- 3. Remove the card from the slot.
- 4. To reinstall the card, note the card position diagram in the finger slot. Push the card into the slot until you hear a click.

Downloading and Deleting Data from the Micro SD Card

- 1. Remove card from the sonde and insert it into a micro SD card adapter.
- 2. Insert the adapter into a PC or laptop.
- 3. Open the micro SD card using the file explorer.
- 4. Open the folder titled "Serial Number.LOG." For example, "424690.LOG."

Logs are named by date and then number. For example, a log started on November 12, 2015 would be named "15111200.CSV" - 15 is the year, 11 is the month, 12 is the day, and 00 is the log number. If multiple logs are recorded on the same day the last number will increase by one for each consecutive log.

5. Select the logs you wish to download and move them to the destination.

6. Select the logs you wish to delete and press Delete on the keyboard. **Deleted logs** cannot be recovered.

Updating Firmware

- 1. Download the firmware update files to your computer.
- 2. Remove the SD card from the unit and insert it into your computer.

You may need a micro SD card adapter to connect the SD card to your computer. One is included with your Aqua TROLL 600, but any micro SD card adapter can be used.

- 3. Copy the firmware update files into the ISI.FW file on the SD card.
- 4. Install the SD card into the instrument and install the battery cover.
- 5. Turn on the LCD screen by inverting the sonde so the sensor end faces up.
- 6. Access the instrument menu by tapping the Aqua TROLL 600 logo on the yellow label three times. For more information on accessing menus, see "LCD Screen" on page 37.
- 7. Scroll to **Updates** by tilting the instrument. Access the Updates menu by tapping the Aqua TROLL 600 logo once.
- 8. Scroll to **Sonde** by tilting the instrument. Tap the Aqua TROLL 600 logo once.
- 9. The LCD screen will display the current firmware version on the left, then an arrow, and the new firmware version on the right.
- 10. Scroll to **Yes** by tilting the instrument. Tap the Aqua TROLL 600 logo once.
- 11. The LCD screen will display icons while updating. Once the update is complete the Aqua TROLL 600 and LCD screen will restart.

Desiccant

The Aqua TROLL 600 contains a small, replaceable desiccant capsule in the battery compartment. This capsule prevents moisture from causing damage to the electronic components. It is filled with color-indicating silica that gradually changes from purple to pink as the desiccant's effectiveness decreases. Replace the desiccant when the desiccant has turned pink. The desiccant is included in the Aqua TROLL 600 Maintenance Kit (0078940).

Replace the Desiccant

- 1. Remove the battery cover.
- 2. Remove the backup wrench tool from the back of the battery compartment.

- 3. Insert the backup wrench into the small hole on the back side of the battery compartment and push the desiccant capsule out.
- 4. Insert a new desiccant capsule and push the capsule in fully using the wrench.


Sensor Calibration

Preparing the Aqua TROLL 600 for Calibration

- 1. Remove the rubber bumper and blue top cap from the restrictor.
- 2. Remove the rubber gasket from the calibration cup and slide it on to the middle of the restrictor.



- 3. Screw the cal cup on the bottom of the restrictor.
- 4. Pour the calibration solution into the cal cup.
- 5. Fully seat the rubber gasket on the top of the cal cup.
- 6. Gently tap the cup and sonde at an angle to remove all bubbles from the sensor faces.



7. If performing an RDO calibration, ensure the gasket notch is lined up with the vent hole of the cal cup.

Sensor calibration procedures vary based on the software you are using to program the instrument. If you are using the VuSitu Mobile App, see "About Calibration and Settings" on page 57. If you are using Win-Situ 5 Software, see "Calibrate Sensors" on page 87.

Calibration Recommendations

In-Situ sensors are factory calibrated across the entire range of each sensor, and thus achieve a very high degree of accuracy and stability for extended periods of time without user calibration. In-Situ recommends inserting the instrument into a known

calibration standard to check the accuracy of a sensor prior to performing any user calibration if you suspect drift, unless a user calibration is required by a standard operating procedure.

Sensor	Recommended User Calibration Frequency	Recommended Factory Calibration Frequency	Notes
Conductivity	Only when required by user protocol	12 months	K-cell value: 0.7 to 1.3
Conductivity + Temperature	Only when required by user protocol	12 months	K-cell value: 0.7 to 1.3
рН	10 to 12 weeks or as required by user protocol or site conditions	12 months	Single point: Theoretical mV ±30 mV 2- or 3-point Slope: -66 to 50 mV/pH 2- or 3-point Offset: 350 to 450 mV
ORP	10 to 12 weeks or as required by user protocol or site conditions	12 months	Offset : ±30 mV
RDO	12 months or as required by user protocol	12 months	2-point Slope : 0.7 to 1.3 2-point Offset : ±0.3 mg/L
Temperature	Only when required by user protocol	Only when required by user protocol	Offset: ±0.5
Turbidity	Only when required by user protocol	12 months	Slope : 0.7 to 1.3
Pressure/Depth	Only when required by user protocol	Only when required by user protocol	<2 times the full scale accuracy specification
Barometer	Only when required by user protocol	Only when required by user protocol	<2 times the full scale accuracy specification

Factory Calibration

Factory calibration of In-Situ instruments should be performed every 12 months, or when the unit data appears to drift significantly. Factory calibration includes a thorough

cleaning, full functionality check, and sensor adjustments to all applicable sensors over the entire calibrated temperature range.

Software

The Aqua TROLL 600 can be programmed using the VuSitu Mobile App for Android, or using Win-Situ 5 Software.

VuSitu Mobile App

Verify the VuSitu Mobile App Version

To avoid potential compatibility issues, it is important to use the most recent version of the VuSitu Mobile App. Find version information and app updates from the Google Play Store.

Connecting with Bluetooth

The Aqua TROLL 600 can connect to a Bluetooth-enabled device for wireless communication with the VuSitu Mobile App or Win-Situ 5.

- 1. Turn on the Aqua TROLL 600 LCD screen by holding the sonde vertical with the sensor end facing up.
- 2. On the Bluetooth-enabled device, navigate to the Bluetooth menu and scan for available devices.
- The Aqua TROLL 600 will be listed as "Serial Number AT600". For example, 424690 - AT600. Tap the device name to pair the Aqua TROLL 600 and the Bluetooth-enabled device.

Connecting to VuSitu

1. Open the VuSitu Mobile App. If you have correctly paired your Aqua TROLL 600 with your wireless device, and the instrument is available, the software will connect and display readings.



If the Searching screen continues to show, tap Choose another device and select the device you are trying to connect to.

Connecting to Win-Situ 5

- 1. Open Win-Situ 5 Software.
- 2. When prompted, "Connect to device now?" click No.
- 3. Click Preferences, then click Comm Settings.

- 4. Select the correct Com port used by Bluetooth, then select the following settings:
 - Baud: 19200
 - Data Bits: 8
 - Parity Bits: None
 - Stop Bits: 1
 - Device Address: 1
 - Mode: Modbus-ASCII
- 5. Click the checkmark, then click the Connect button in the lower right hand corner.

VuSitu Overview

About VuSitu

The VuSitu Mobile App is the user interface and control application for In-Situ water quality instruments. You can use VuSitu on mobile devices that use Android operating system 4.4, *Bluetooth* 2.0, and newer.

VuSitu allows you to accomplish the following tasks.

- View live readings that update every 10 seconds.
- Change parameters and units.
- Set up a data log.
- Record data.
- Email data in spreadsheet format.
- Download data to mobile device.
- Transfer data from mobile device to a computer.
- Organize data by Location.
- Calibrate Sensors and View Reports

VuSitu Menu Options

The features available in the VuSitu Mobile App vary slightly depending on the instrument with which it is connected. Tap the menu icon in the upper left portion of the screen to view the features included in VuSitu. Tap the menu icon again to close the menu.

Menu Options when Connected to Instrument

Some features, such as sensor calibration, are not available when you are not connected to an instrument.



Live Readings Screen


The live readings screen displays instrument readings when the app is connected to the communication device and/or to the instrument via Bluetooth.

	8	┉णि 🛱 🖓 👘 📶 63%	5:06 PM
(1)	Live Readir	ngs	1
	AquaTROL	L 600 - SN 423297	
2		It Location provided location Chai	nge Location >
Barometr	ic Pressure	12.04 psi	\$
3	Pressure	0.13 psi	Φ
	Depth	0.26 ft	ф
Т	emperature	24.59 °C	Ф
Actual C	onductivity	0.00 µS/cm	ф
sp 4 3	onductivity	0.00 µS/cm	-0-
	📑 Sta	rt Recording	
	\triangleleft	0 [
1	Main Mer	าน	
2	Selected	Location	
۷	(Tap to c	hange Location.)	
	Live Rea	dinas (scrollable))

2	Selected Location
2	(Tap to change Location.)
	Live Readings (scrollable)
3	Tap the settings wheel next to each to change parameters and units.
4	Tap to record readings (Readings refresh every 10 seconds.)
	,

Changing Parameters and Units

1. From the Live Readings screen, tap the settings wheel next to the field that contains the measurement value. When you release, the Parameter and Unit menu appears.

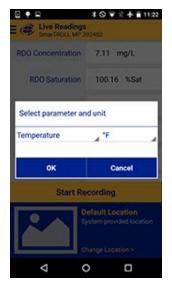

- 2. Tap the parameter drop-down arrow and tap the parameter you want to display.
- 3. Tap the units drop-down arrow and tap the unit you want to display.
- 4. Tap the OK button to set the options and return to the Live Readings screen.

Record Data

- 1. From the Live Readings screen, tap Start Recording. A new set of readings is updated every 10 seconds and a counter of readings is displayed in the Stop button.
- 2. It is optional to mark a set of readings by tapping the Mark button.



- 3. When you have gathered enough data, tap the Stop button.
- 4. The recorded data appears on screen. If you have marked data it will appear as a highlighted row.



Close		Save to
\bigtriangledown	0	D

- 5. If you want to return to the Live Readings screen, tap the Close button. (Your data can be accessed later in the Data section of the app.)
- 6. If you want to send your data, tap the Send To... button.

100	Well	ii.				3:29
Live	Rea	ding	s Rej	oort		
Device Locatio	SN: 3- on Nan ime: 7 on: 00:	16745 te: We /31/20			A -06:00	
Date	Time	RDO C	Concent	ration	(mg/L) (15	9088
3231	1 PM				6.3	3012
20	e to					
231	e 10					
Sam		itu Fo	lder			
Saw Saw	VuS	itu Fo Save ti				
Saw Saw	VuS ES S		o			

• Select the VuSitu Folder to later download your data to a computer via USB connection.

or

• Select your email application to email the data.

VuSitu Locations

About VuSitu Locations

A Location represents the physical location at which an instrument collects data. For example, you can create a Location to represent a lake, gauging station, well, tank, number, or nearby landmark. If you do not set up a Location, your data will be associated with Default Location. The Location name is displayed on the Live Readings screen. You can access Locations through the Main Menu or by tapping the Location displayed in the lower portion of the Live Readings screen.

Create a New Location

- 1. You can create a new Location with which to associate your data by selecting Locations from the main menu, or by tapping the location shown on the Live Readings screen.
- 2. Tap Add New Location.
- 3. Enter a name for the Location.
- 4. It is optional to add a photo to the Location. Tap the camera icon, take a photo and select the check mark to select the photo.
- 5. It is optional to add notes to the Location. Tap the Notes field to enter additional information about the Location.
- 6. It is optional to associate latitude and longitude coordinates with the Location. Tap the map to activate the mapping feature.



- 7. Tap the GPS icon (1) in the upper-right portion of the screen to navigate to your current physical location.
- 8. Tap the Location icon 9 to select the point on the map as the Location.
- 9. To manually set a Location, tap and hold to drop a pin on a specific area of the map. This associates latitude and longitude with your Location.



As an alternative, you can manually enter latitude and longitude values and tap Apply.

10. Tap Save.

Select a Location

Data is associated with the Location that is displayed on the Live readings screen.

After you have created a Location, you must select it in order for your data to be associated with the Location.

1. To Select a Location, tap the current Location displayed on the Live Readings screen. The list of Locations appears.



- 2. The active Location is marked with a green check mark. If no Location has been selected data will be associated with the Default Location.
- 3. Tap the desired location in the list.



4. The Live Readings screen appears with the site selected.




Edit or Delete a Location

- 1. From the Main Menu, tap Locations.
- 2. Tap the Location you want to edit.



- 3. Tap the Overflow Menu in the upper-right portion of the screen.
- 4. Select Edit Location to make changes, or Archive Location to remove it from the list.



VuSitu Data

About Data

Recorded data from the Live Readings screen is stored in the VuSitu Data section of the app. Data is organized by the Location that was active when the data was recorded. You can view data on the device, delete the data, send the data through email, or save the data to the VuSitu Folder so that it can be downloaded to your computer via USB connection.

View, Send, Delete Data

1. From the Main Menu, select Data.





It is optional to filter results by Location. Tap the drop-down list and select a Location.

2. Tap the desired data.

Data		ថ) 📅 📶 84% ∎3:13 PM
All Loca Well 172 8/27/2015 2		A
Delete	View	Send CSV
	:56:00 PM - Live Read	-

- Tap Delete to remove the data from the data list.
- Tap View to see the data on the mobile device.
- Tap Send CSV to send an Excel-compatible file to email or the VuSitu Folder. (When you send the report to the VuSitu Folder, you can later download the data to a computer via USB cable.)

VuSitu Calibration & Settings

About Calibration and Settings

You can perform sensor calibrations, view a calibration report, or restore factory calibration defaults when the instrument is connected to VuSitu.

- 1. Tap the VuSitu menu icon, and select Connected Instrument from the list.
- 2. Tap Calibrations.
- 3. The available calibrations and sensor settings appear.



4. Tap the calibration you want to perform.

You can also access the full Calibration Report from this menu.

Quick-Cal Multiple Sensor Calibration

Quick-Cal allows you to perform a one-point calibration on up to three sensors with one setup and stabilization process.


- 1. From the main menu, select **Connected Instrument**.
- 2. Select Calibrations.
- 3. From the Calibration Menu, select Quick-Cal (multi-sensor).



4. All of the sensors available for the Quick-Cal calibration are selected by default. Tap the checked box if you want to exclude a sensor from the calibration.

16			****	0 2
#	Quick-Cal	Calibratic	n	
	SmarTR	OLL MP - SN	346745	
	A Sens	ors for Q	uick-Cal	
Sele	ct the sensors	to include	n this calibra	rtion.
•	Conductivity	Sensor		
ø	pH Sensor			
•	ORP Sensor			
	Cancel		Next	
	4	~	-	

5. Select Next.



6. Make sure the vent is open on the cal cup.



- 7. Fill the cup to the fill line with Quick-Cal standard. Place the instrument in the calibration cup and select **Next**.
- 8. After the calibration is stable, select Accept.
- 9. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
- 10. Rinse the sensors and restrictor with DI water.

Calibrate the Rugged Dissolved Oxygen Sensor (1-Point)

The optical Rugged Dissolved Oxygen sensor is very stable. The factory calibration should produce readings within 3% accuracy. If you require readings with greater accuracy we recommend that you perform a 1-point, 100% water-saturated air calibration as described below.

100% Water-saturated Air Calibration

- 1. From the main menu, select **Connected Instrument**.
- 2. Select Calibrations.
- 3. From the Calibrations menu select **RDO Saturation**.
- 4. For a 1-point calibration, select 100% Saturation.
- 5. Make sure the vent is open on the cal cup.



- 6. Place a small amount of clean water in the bottom of the cup.
- 7. Agitate the water by shaking the cup slightly from side to side.
- 8. Screw the Aqua TROLL 600 on to the cal cup and wait for 5 minutes.
- 9. Tap Next in the app to start the calibration.
- 10. After the calibration is stable, select Accept.
- 11. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.

Calibrate the Rugged Dissolved Oxygen Sensor (2-Point)

We recommend that you perform the 0 % oxygen calibration only if you intend to measure dissolved oxygen at a concentration of less than 4 mg/L.

100% Water-saturated Air Calibration

- 1. From the main menu, select Connected Instrument.
- 2. Select Calibrations.
- 3. From the Calibrations menu select RDO Saturation.
- 4. For a 1-point calibration, select 100% Saturation.
- 5. Make sure the vent is open on the cal cup.



- 6. Place a small amount of clean water in the bottom of the cup.
- 7. Agitate the water by shaking the cup slightly from side to side.
- 8. Screw the Aqua TROLL 600 on to the cal cup and wait for 5 minutes.
- 9. Tap Next in the app to start the calibration.
- 10. After the calibration is stable, select Accept.
- 11. After the calibration is stable, a prompt to prepare for the next calibration point appears.

0-point Calibration

- 1. Fill the calibration cup to the fill line with sodium sulfite. Place the instrument in the calibration cup.
- 2. Select Next.
- 3. After the calibration is stable, select Accept.
- 4. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
- 5. Rinse the sensors and restrictor with DI water.

Calibrating the Rugged Dissolved Oxygen Sensor Using Concentration

The preferred method of calibrating the RDO sensor is using the 1-point 100% Saturation calibration. However, you can also calibrate the sensor using a concentration method.

- 1. From the main menu, select **Connected Instrument**.
- 2. Select Calibrations.
- 3. Tap RDO Concentration.
- 4. Place the instrument in reference solution and tap Next.
- 5. Enter the value of the reference solution.

- 6. After the calibration is stable, select Accept.
- 7. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.


RDO Salinity Setting

The SmarTROLL RDO does not include automatic salinity compensation, so you must set it manually.

- 1. From the main menu, select **Connected Instrument**.
- 2. Select Instrument Settings.
- 3. From the Instrument Settings menu select Salinity Setting.
- 4. Select the appropriate setting for your sampling environment.

Calibrate the Conductivity Sensor

- 1. From the main menu, select **Connected Instrument**.
- 2. Select Calibrations.
- 3. From the Calibration Menu, select Conductivity.

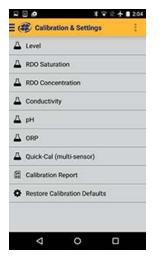

4. Make sure the vent is open on the cal cup.



- 5. Fill the cup to the fill line with calibration standard. Place the instrument in the calibration cup and select **Next**.
- 6. The app attempts to automatically detect the calibration solution and stabilize the measurements.


and the second	
Calibration	
L MP - SN 346745	
tivity Calibration	•
25 °C	4
Auto Detecting	- 0
0.27 µS/cm	
0.27 µS/om	
24.68 °C	
llizing ···•	
	Auto Detecting 0.27 µS/cm 0.27 µS/cm 0.27 µS/cm 24.68 °C

7. Check your bottle of calibration standard to determine the reference temperature. If necessary, tap the drop down list and select the appropriate reference temperature for the calibration.

Conductivity		
SmarTroll	MP - S/N 346745	
Calibratio	n Point 1 of 1	
Calibration Standard @	25 °C	
Conductivity Standard		/cm
Specific Cond. @ 25°C	1,396.0 µS/cm	0
Actual Conductivity	1,300.2 µS/cm	0
Temperature	21.41 °C	0
Non Cancel	ninal D	
Cancel	Accept	

If you are using a custom standard, the app will not automatically detect it. Instead, a field will appear in which you can enter the appropriate value. Select **Set User Defined** to begin calibrating with the new value. If you are not using a custom standard and the app does not automatically detect the standard, perform the sensor cleaning and maintenance procedure, then select **Retry Auto Detect**.

8. After the calibration is stable, select Accept.

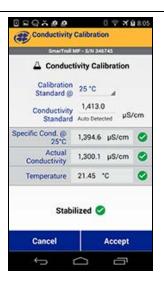

- 9. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
- 10. Rinse the sensors and restrictor with DI water.

Calibrate the Level Sensor

The factory calibration of the level sensor is very accurate. In-Situ does not recommend calibrating the Level sensor unless your SOP specifically requires you to do so.

- 1. From the main menu, select Connected Instrument.
- 2. Select Calibrations.
- 3. From the Calibrations menu select Level.
- 4. Make sure that the pressure sensor is open to air and not submersed in water.
- 5. Select Next.
- 6. After the calibration is stable, select Accept.

Calibrate the pH Sensor

You can calibrate the pH sensor with either a 1-point, 2-point, or 3-point process.

- 1. From the main menu, select **Connected Instrument**.
- 2. Select Calibrations.
- 3. From the Calibrations menu select pH.



- 4. Select a 1-, 2-, or 3-point calibration.
- 5. Make sure the vent is open on the cal cup.




- 6. Fill the calibration cup to the fill line with calibration standard. Place the instrument in the calibration cup and select **Next**.
- 7. The app attempts to automatically detect the calibration solution and stabilize the measurements.
- 8. If you are using a custom standard, the app will not automatically detect it. Instead, a field will appear in which you can enter the appropriate value. Select Set User Defined to begin calibrating with the new value. If you are not using a custom standard and the app does not automatically detect the standard, perform the sensor cleaning and maintenance procedure, then select Retry Auto Detect.
- 9. After the calibration is stable, select Accept.

Calibrate the ORP Sensor

The ORP sensor can be calibrated using Zobell's standard, Quick-Cal or a custom ORP solution.

- 1. From the main menu, select **Connected Instrument**.
- 2. Select Calibrations.
- 3. From the Calibrations menu select ORP.

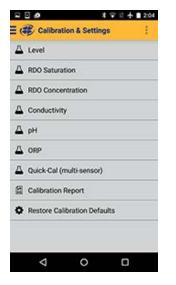

4. Make sure the vent is open on the cal cup.



- 5. Fill the calibration cup to the fill line with calibration standard. Place the instrument in the calibration cup and select **Next**.
- 6. The app attempts to automatically detect the calibration solution and stabilize the measurements.

If you are using a custom standard, the app will not automatically detect it. Instead, a field will appear in which you can enter the appropriate value. Select **Set User Defined** to begin calibrating with the new value. If you are not using a custom standard and the app does not automatically detect the standard, perform the


sensor cleaning and maintenance procedure, then select **Retry Auto Detect**.

- 7. After the calibration is stable, select Accept.
- 8. The calibration values are applied to the sensor and appear on screen. You can view a full calibration report for all sensors, or select **Done** to return to the Calibration Menu.
- 9. Rinse the sensors and restrictor with DI water.


Calibrate the Turbidity Sensor

You can calibrate the Turbidity sensor with either a 1-point, 2-point, or 3-point process.

- 1. From the main menu, select **Connected Instrument**.
- 2. Select Calibrations.

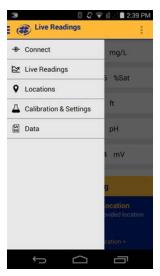

3. From the Calibrations menu select Turbidity.

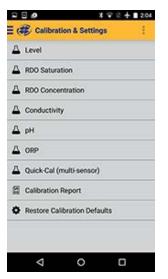

4. Select a 1- or 2-point calibration.

5. Make sure the vent is open on the cal cup.



- 6. Fill the calibration cup to the fill line with calibration standard. Place the instrument in the calibration cup and select **Next**.
- 7. The app attempts to automatically detect the calibration solution and stabilize the measurements.
- 8. If you are using a custom standard, the app will not automatically detect it. Instead, a field will appear in which you can enter the appropriate value. Select Set User Defined to begin calibrating with the new value. If you are not using a custom standard and the app does not automatically detect the standard, perform the sensor cleaning and maintenance procedure, then select Retry Auto Detect.
- 9. After the calibration is stable, select Accept.

Win-Situ 5

Verify the Win-Situ Software Version

To avoid potential compatibility issues, it is important to use the most recent version of Win-Situ Software. Find version information and the most recent software download on the In-Situ website *www.in-situ.com*.

Win-Situ 5 Screens and Buttons

Data Tab

When you open Win-Situ 5 Software, the **Data** tab appears. The left side of the screen contains a file tree where you can view previously downloaded site data as well as data you have exported to Microsoft Office Excel. The links on the right side of the screen show where downloaded data are stored on your computer. The disconnected plug

icon in the lower-right corner of the screen indicates that the software is not yet communicating with an instrument.

Win-Situ® 5 File Edit View Tools	Preferences Help			
			F	
Forne Connections Ste Data Exported Data		C:\Users\mcrowell\Doc	uments\WinSitu Data\	
		1	🕅 In-Situ In	c. - C.

Screen Element	Definition
	The disconnected plug indicates the instrument is not communicating with the software. Click to establish communication with a connected instrument.
	The connected plug indicates the instrument is communicating with the software. Click to disconnect the software from the instrument.
	The Home tab displays real-time readings from the instrument. When connection to the instrument is first established, the software displays one reading of all available parameters in light gray. You must click the Play button to view real-time readings.
	The Logging tab displays a list of logs stored in the connected instrument. When you click the Logging tab, it can take a moment for the software to retrieve information from the instrument. (Not applicable for the RDO PRO-X and the Aqua TROLL 400.)

Screen Element	Definition
	The Sensors tab lists the sensors in the connected instrument, along with their serial numbers and the dates of factory calibration and user calibration. Use the buttons in this tab to calibrate sensors that support user calibration and configure sensors that are supported by the instrument.
	The Device Setup tab allows access to instrument information and settings such as instrument name, serial number, firmware version, communication settings, diagnostics, and factory reset options.

Home Tab

The **Home** tab displays real-time readings from a connected instrument. When you first establish communication, the software displays one reading of all available parameters in light gray.



 Screen Element
 Definition

 Image: Screen Element
 The Sites button allows you to add, edit, or delete a site. Click the drop-down arrow next to the button to view the list of sites.

 Image: Screen Element
 The Sites button allows you to add, edit, or delete a site. Click the drop-down arrow next to the button to view the list of sites.

 Image: Screen Element
 The Sites button allows you to add, edit, or delete a site. Click the drop-down arrow next to the button to view the list of sites.

 Image: Screen Element
 The Device Memory gauge turns yellow when the internal memory is used. Note: Non-logging instruments do not have internal memory, however, the gauge shows 100 percent green when power is applied.

Screen Element	Definition
¥	The Device Battery gauge turns yellow as the battery is depleted. This example shows 80 percent of the battery remaining (green) and 20 percent used (yellow). Note: Non-logging instruments do not have internal batteries, however, the gauge shows 100 percent green when power is applied.
	The Logging Status icon:
	Green–The instrument is actively logging data.
	Gray–The instrument has no logs pending or running. Non- logging instruments always show a gray status icon.
	Yellow–The instrument has log data that was collected according to specific instructions in the "Pending" or "Suspended" state.
	The Alarm icon provides additional instrument status information.
	Green–No alarms or warnings
	Yellow–One or more warnings
A	Red–One or more alarms
	Move the cursor over the alarm icon to view a description. Click the Device Setup tab for detailed information on the alarm or warning.
	Note: Disregard the Device Reset alarm for non-logging instruments such as the RDO PRO Probe or the Aqua TROLL 400.
8/13/2012 8/13/2012 11:18:04 AM 11:18:04 AM	System Time is displayed on the left. Device Time is displayed on the right. Clocks are updated once every two seconds. When the Device Time is displayed in red, it differs from the current System Time, and should be synchronized.
5	The Time Sync button is used to write the current PC time to the instrument. If you need to set the instrument clock to a time other than the system (PC) time, use the Set Clock button on the Device Setup tab.
	Meter View shows the last known parameter values, displayed with current units and time stamp. Readings are sized to occupy the entire screen. This is the default display in the Home tab. If the type is black, the readings are updating in real time.
	List View is a running list of the most recent records. New readings are continuously added to the top of the list and old readings scroll off the bottom.

Screen Element	Definition
R	Graph View shows a real-time trend graph of the selected parameters.
*	The Snapshot button records one set of readings.
	The Record button logs data to a CSV file that can be opened in a spreadsheet program. This is not the same as recording data in a log on the instrument.

Logging Tab

The **Logging** tab displays a list of logs in the instrument. When you click the **Logging** tab, it may take a moment for the software to retrieve information from the instrument.

Win-Situ® 5 File Edit Vie	w Tools Prefere	nces Help					
	K		» «»		/	Ø	
Level TR	OLL® 700		S/N 122219		S		¥ # A
a 60			-		8	8/30/2013 2:07:30 PM	8/30/2013 2:07:30 PM
🕂 Site	Log Name	Туре	Start Time	Scheduled Stop Time	Stop Time	Status	Used Size (Kbytes)
	m	Linear	8/30/2013 3:00:00 PM			Pending	64
	E'	 Control 		R	QI	n-Situ	Inc. 🗨

Log Information

Columns across the Logging screen show information about the logs in the instrument.

- Symbol–This is a graphic representation of the information in the Status column.
- Site-The site that was specified when the log was configured.
- Log Name-The name that was entered when the log was configured.
- Type–The logging method that was selected when the log was configured.
- Start Time—For a Pending log, the scheduled start time is shown. For a Ready log that has not yet started, this column displays "Manual." For a Running or Stopped log, the actual start time is shown.

- Scheduled Stop Time—For a log with a scheduled stop, the scheduled stop time is shown. For a log without a scheduled stop time, this column is blank.
- Stop Time–For a Pending or Ready log, this column is blank. For a Running log, the time of the last data point is shown. For a Stopped log, the actual stop time is shown.
- Status–Each log has a specific status. See Log Status for details.
- Used Size-Kilobytes of instrument memory allocated for this log. For a Pending or Ready log, the current size of the log configuration is shown. For a Completed log, the size of the entire log file is shown. For a Running log, the current size of the log up to the last data point is shown.

Log Status

The status of each log in the instrument is displayed in the Logging tab by a symbol beside the log name, and in the Status column.

Bready–Manual Start log is ready to start.

Pending–Scheduled start log is ready to start at its programmed time, or when you click the Start button.

Running–The log is actively logging data.

Suspended–The log has been paused (stopped temporarily).

Stopped–The log has been stopped, either manually or on a schedule.

Deleted—The log has been marked for deletion and will be deleted from the instrument when memory is needed. The software manages this automatically.

Invalid—The log as programmed cannot be run.



Ready, **Pending**, **Running**, and **Suspended** logs are considered active. Only one log can be active in the instrument.

Log Control Buttons

You can control the status of a log by selecting the log and clicking the appropriate button in the **Logging** tab control panel:

The Start button starts a Ready or Pending log, or resumes a Suspended log.

U The **Pause** button pauses a **Running** log allowing you the option to resume it.

The **Restart** button restarts the selected **Running** log from the beginning. This can be useful during aquifer testing using a logarithmic data collection schedule.

The **Stop** button permanently stops the selected **Running** log.

Log Operations

Use the buttons in the control panel to perform the following actions:

Create a new log.

The **New** button is disabled if a Ready, Pending, Running, or Suspended log is on the instrument. When the instrument contains its maximum number of logs, the New button is unavailable.

Edit (or review) the log configuration for a Ready, Pending, or Invalid log.

Delete the log. (Note that you must delete a log twice before it is permanently removed.)

Download the log to a PC.

Sensors Tab

The **Sensors** tab lists the sensors in the instrument, along with their serial numbers and calibration dates. Use the buttons in this tab to calibrate and configure sensors.

🚾 Win-Situ® 5					
File Edit View Tools Preferences					
	- W			l C	2
Level TROLL ® 500	S/N 1	11860		sh 💳	• ¥ 💶 🖬 🏨 👔
Fort Collins 1		¥		8/20/20 11:19:05	12 8/20/2012 AM 11:19:00 AM
Sensor	Serial Number	Factory Cal Date	Next Factory Cal Date	Last User Cal Date	Next User Cal Date
Pressure/Temp 5 PSIG (3	111860	11/9/2006 10:22:12 AM	11/9/2007 10:22:12 AM	9/22/2011 1:05:41 PM	
T T)			Q In-Si	tu Inc. 💽

Calibrate

Use the **Calibration** button to calibrate sensors or to adjust a level reference that is currently stored on the instrument. The **Calibrate** button is not available when the instrument does not support calibration (e.g. BaroTROLL Instrument).

1. With the instrument connected to the software, select the Sensors tab.

Ø

- 2. Select the parameter you intend to calibrate.
- 3. Click the Calibrate button

Configure

Use the **Configure** button to select parameter units and to configure parameters that support configuration. Examples include Level/Depth, Specific Conductivity, and Total Dissolved Solids. Parameters cannot be configured while the instrument is showing live data on the **Home** screen or while the instrument contains an active log.

- 1. With the instrument connected to the software, select the Sensors tab.
- 2. Select the parameter you intend to configure.

3. Click the **Configure** button



When you configure the Level parameter using the **Sensors** tab, the settings are stored in the instrument and are available for use in Modbus, SDI-12, or analog communication (if available). If desired, a different configuration can be selected when setting up a log.

Device Setup Tab

Win-Situ® 5 File Edit View Tools Preferences Help			<u>_ </u>
Level TROLL® 500 S/N 111860 Fort Colins 1	¥	820/2012 1157-32 AM P 1157-27 A	
Device Information Name: Level TROLL 1 Manufacture Date: 11/9/2006 Firmware Version: 2.02 Hardware Version: 1 Boot Version: 1 Manual Time Set 8/20/2012 Bovice Firmware Update Available Firmware Versions Level TROLL 500 v2.02 Update Device SDI-12 Setup Modbus Setup SDI-12 Setup	Device Status Sensor High Sensor Low Sensor Calibration Sensor Malfunction Hardware Reset Device Malfunction Low Battery Low Memory	Power Management: Enabled Status: Onine External Power: None Disable Power Management Clear Status Factory Reset Diagnostics Go Offline	
		🕄 In-Situ Inc. 🗧	

The **Device Setup** tab allows you to set hardware settings and view instrument status such as:

Device Information

- You can set the instrument name here. There is a 32-character limit. Type the name and click the **Set Name** button. A device name cannot be set while the device contains an active log.
- The other device-specific information displayed in this area is not userchangeable.
- Manufacture Date
- Firmware Version–If the firmware version is displayed with a red background, this indicates a later version is available and the device should be updated.
- Hardware Version
- Boot Version–This is the software used by the device to upgrade its firmware.

Manual Time Set

You can set the instrument clock to a time other than the PC (system) clock. Select the

new time and click the Set Clock button.

Device Firmware Update

The **Available Firmware** drop-down list in the **Device Setup** tab displays all available firmware for the connected device arranged by version from newest to oldest. To update the device firmware, select the firmware version you want from the drop-down list and click the **Update Device** button. Firmware cannot be upgraded while the device is profiling or contains a log in the Ready, Pending, Running, Suspended, or Invalid state, as shown on the **Logging** tab. Downgrading the device to a lower firmware version is not recommended.

Device Status

This area of the **Device Setup** tab shows the details of instrument alarms and warnings indicated by the bell-shaped alarm icon.

Status colors:

Gray-No alarms or warnings

Yellow-Warning

Red–Alarm

- Sensor High: An alarm or warning when values reported by a sensor have exceeded a user-set "high" alarm or warning threshold.
- Sensor Low: An alarm or warning when values reported by a sensor have dropped below a user-set "low" alarm or warning threshold.
- Sensor Calibration: A warning when factory calibration expires or when a user calibration date has passed.
- Sensor Malfunction: This alarm lights when a water-quality sensor malfunctions.
- Hardware Reset: This warning indicates that the device has reset itself following a serious interruption, such as a lightning strike. If the device clock is lost during logging, the log will resume when the device recovers from the reset, at whatever time is then active in the device. Disregard this warning for non-logging instruments.
- Device Malfunction: An alarm is activated when the device has malfunctioned. Call Technical Support.
- Low Battery: An alarm is activated when 5 percent of the device battery capacity remains.
- Low Memory: An alarm is activated when 5 percent of the device memory capacity remains.

Buttons in this area of the **Device Setup** tab are used to set up alarms, clear alarms, and take the device offline. To clear an alarm indicator, click the **Clear Status** button.

Factory Reset

To restore factory settings in the device (less any firmware upgrades), click the **Factory Reset** button in the **Device Setup** tab.

A factory reset removes all logged data from the device. This button is not available if the device is profiling or contains an active log.

Analog Setup

To configure the device for 4-20 mA output, click the **Analog Setup...** button in the **Device Setup** tab. Analog is not supported on all instruments.

SDI-12 Setup

To configure the SDI-12 output from the device, click the **SDI-12 Setup...** button in the **Device Setup** tab.

Alarm Setup

To configure the instrument alarm and/or warning indicators, click the **Alarm Setup...** button in the **Device Setup** tab.

Modbus Setup

These settings permit devices on a network and devices connected via a gateway such as a modem or TCP/IP to be changed independent of the connection link. To configure the device communication settings, click the **Modbus Setup...** button in the **Device Setup** tab.

Win-Situ 5 Logging and Viewing Data

About Sites

All data logged by In-Situ instruments are tied to a specific site. A site represents the physical location where the instrument collects data. For example, you can create a site to represent a lake, gauging station, well, or nearby landmark.

You are prompted to select a site when you set up a data log. A default site is loaded with the software, and can be used, but it does not provide any specific information about the place where the data was collected.

- When you set up a new site, a **Site** folder with the same name is created in the folder tree on the **Data** tab. Site folders are designated by this icon
- When you set up a data log, the first thing you are asked to supply is a site.
- When you download a data log, it appears in its **Site** folder in the folder tree on the first screen Data tab. See page 70. This provides a convenient way to organize data collected from the same instrument at different locations, or from different instruments at a common location.

Sites are stored in a database on your computer in your Win-Situ working directory. <u>More information</u>. After a new site is added, it is available to select for any instrument and any log.

Only one site at a time is programmed in the instrument and it is shown in the Site box at the top of the screen.

For additional information see:

Adding a New Site

Managing Sites

Logging Data—Overview

Win-Situ provides many ways to customize the collection of field data.

- Schedule the instrument to start and stop a log at a specified time.
- Set up a log and start it manually. While the instrument is connected to the software, you can watch the first few readings in tabular or graphical form. Disconnect from the software and let the instrument collect data. Manually reconnect to the instrument and download the collected data at any time.
- Start a log, check the data, pause the log, reposition the device, restart the log.
- Download data logs to folders on your PC.

What do you want to do?

- Set up a new data log.
- Start a log that has been set up in the instrument.
- View the logs on the instrument.
- Download a log to my PC.
- Stop a log that is running on the instrument.
- Suspend (temporarily stop) a log that is running in the instrument.
- Delete a log from the instrument.

Logging Method Descriptions

The following is a list of log types and their descriptions. The log types that are available on an instrument vary depending upon the capabilities of the instrument.

Logging Methods for Long-Term Monitoring

Linear

Linear log type measures and records at a user-defined fixed interval of one minute or more. This method is used for long-term studies, landfill monitoring, stream gauging, tidal studies, and background monitoring prior to aquifer testing. Intervals are measured in days, hours, or minutes.

Linear Average

Linear Average log type can smooth out anomalous highs and lows that may occur in a data set, for example, when a water wave passes over the instrument. Each stored measurement is the average of several rapid measurements. This method is used for long-term studies, stream gauging, tidal and open-water studies where trends are more important than accuracy. Intervals are measured in days, hours, minutes, or seconds.

Event

Linear Event log type combines basic fixed-interval logging of specified parameters with the ability to log data at a faster interval when a single-parameter event condition is present.

When logging conductivity, please note that the faster event interval logging can occur only if external power is present.

Log Setup

The Log Setup Wizard presents sequential screens to help you supply all the information necessary to set up a data log in the instrument.

To access the Log Setup Wizard the instrument must be connected to the software.

- 1. Click the Logging tab
- 2. Click the New button

The **New** button may be disabled or may show a warning if an active log already exists on the instrument, or if the instrument is polling live data (see the **Home** screen), or if the device already contains its maximum number of logs.

- 3. Select the Site where the set of data will be logged and supply a name for the log.
- 4. Click the **right arrow** to continue after each step.
- 5. Select the parameters you intend to measure, choose the measurement units, and specify the order in which the selected parameters will be logged.
- 6. Select the logging method you intend to use. See page 80.
- 7. Select the log interval. A log interval is how often a measurement will be taken and stored.
- 8. Select the start condition, stop condition, and specify how to handle full device memory.
- 9. If you selected **Level** or **Depth** as a parameter to measure, specify how you intend to log this parameter. <u>More information.</u>
- 10. If you selected **Specific Conductivity** as a parameter to measure, you have the option to choose a method for converting actual conductivity to specific conductivity.
- 11. If you selected **Total Dissolved Solids** as a parameter to measure, you have the option to edit the default conversion factor used to calculate total dissolved solids from specific conductivity.
- 12. The final screen summarizes the log setup. Click the **check mark** to write this information to the instrument.

Starting a Log

Every log is programmed for either a manual or a scheduled start. A log with a manual start time is displayed in the Logging screen with **Ready** in the **Status** column. A log with a scheduled start time is displayed with **Pending** in the **Status** column.

Starting a Pending Log

A **Pending** log automatically starts at the scheduled time without any user intervention.



A scheduled log with **Pending** status can be manually started at any time before its scheduled start.

Starting a Manual Log

With the instrument connected to the software, select the Logging tab.

Select the Ready log you want to start.

Click the **Start Log** button . The log starts and the symbol changes. The **Status** column displays **Running**.

Suspending (Pausing) a Log

A running log may be temporarily paused. For example, you might want to reposition an instrument, calibrate a sensor, or clean a sensor and later resume the log. A log can be suspended and resumed three times.

- 1. With the instrument connected to the software, select the Logging tab
- 2. Select the log you intend to suspend.
- 3. Click the Suspend button . Suspended appears in the Status column.

Resuming a Suspended Log

- 1. To resume logging after a log has been suspended, select the Logging tab.
- 2. Select the **Suspended** log.
- 3. Click the **Start Log** button . Logging resumes. **Running** appears in the **Status** column. The data file will show the time when the log was suspended and the time when it restarted.

Stopping a Log

A log can be manually stopped at any time, even if a stop time has been previously scheduled. If you did not specify a stop condition when you defined the log, the log will run until the instrument is out of memory or battery power, or until you manually stop it.

A log that has been stopped cannot be resumed. If you intend to resume a log later, you should suspend a log rather than stop it.

- 1. To manually stop a log, the instrument must be connected to the software.
- Select the Logging tab
- 3. Select the running log you intend to stop.
- 4. Click the Stop Log button 💷 .

Restarting a Log

Restarting a log is useful when you are conducting aguifer testing and you want to begin collecting rapid data without configuring and starting a new log.

- 1. The **Restart Log** feature is only available for a running log. In the **Logging** screen select a running log.

2. Click the **Restart Log** button *(Solar)* to restart the log from the beginning.

To resume a suspended log, use the Start Log button . not the **Restart Log** button.

Downloading Data to a PC

This procedure copies the data log from the instrument to a PC. It does not remove the data log from the instrument. After a log is downloaded, it can be exported to a CSV file format that can be used by spreadsheet programs. The time shown in the log name is the time the log was downloaded.

- With an instrument connected, select the Logging tab
- 2. Select the log you intend to download.
- 3. Choose a Running, Suspended, Stopped, or Deleted log.
- 4. Click the **Download button**.
- 5. In the next screen, select one of the three download options.
 - All data
 - New data (data logged since the last download)
 - Time interval to download

New data is downloaded by default to a new log file. To append new data to the last download of this log, be sure the option "Append logs on download" is selected in the General Settings dialog (Preferences > General Settings).

- 2. The log is copied to the connected PC into your Win-Situ working directory folder. View or change the working directory using **File > Settings**.
- 3. At the end of the download, Win-Situ gives you the option of viewing the data.

- Select Yes and the log is displayed in the Data screen.
- Select **No** and the **Logging** screen appears. You can view the data at any time by selecting it in the **Data** tab.

Viewing Logged Data

- 1. To view the data stored in the instrument, you must first download the data. A connection to an instrument is not needed after the data log has been downloaded.
- Select the Data tab
- 3. On the left side of the screen, select the log you want to view. To expand a folder shown in the navigation tree, double-click the folder. The content of the data log is displayed on the right side of the screen in text or graph format.



To switch between view formats, click the **Text** or the **Graph** button in the control panel. To customize the text or graph view, select **Preferences > Graph Settings** or **Preferences > Data View Settings**. These options apply to all downloaded data until you change the options.

Exporting Data

Exporting Data to Spreadsheet Format

- 1. Download the log from the instrument to your PC.
- Select the Data tab
- 3. On the left side of the screen, select the log you intend to export. The content of the log is displayed on the right side of the screen.



To export all of the logs in the site, select the site.

- Select File menu > Export to CSV. The log is exported to the Exported Data folder into a sub-folder with the same name as the data site of the log. If the folder does not yet exist, Win-Situ creates it.
- 5. To open the CSV file, do one of the following:
 - Double-click the exported file in the navigation tree on the left side of the Data tab
 - Access the file in Windows Explorer and double-click the file (for example: C:\ My Documents \ Win-Situ Data \ Exported Data \ my data site \ drawdown test 2006-05-28 11-00-00).

Exporting to Text

To export one or more data logs to text format, follow the steps above, except at step 5 select **File** menu > **Export to Text**. Double-click the exported file to open it in Windows Notepad or your default text editor.

Graphing Data

Real-time data and downloaded log data may be viewed in text (default) or graphic form.

View a Graph of a Downloaded File

- 1. Click the Data tab 💋.
- 2. Select a downloaded log file from the list on the left. Log files are located in the site folders.
- 3. Click the Graph button

View a Graph of Real-Time Data

- 1. With an instrument connected to the software, click the Home tab
- 2. Click the Start button
- 3. Click the Graph button

Graph Settings

The initial display uses the default graph settings (**Preferences** menu > **Graph Settings**) for all graphs. Each log file can have its own customized graph settings that are saved with the log file.

The defaults are as follows.

- All log channels are shown in the order in which they were logged.
- X axis (time) is across the bottom and is auto-scaled.
- Y axis (values), one for each channel, are stacked along the left side of the graph and are auto-scaled to show the full range of the data.

Graph Templates

If you have saved any custom graph templates, you can select one with the **Load Template** button.

Graph Tools

The graph control tools are described below. Each has a toolbar icon and a keyboard shortcut. Holding down the shortcut keys temporarily switches the graph control mode. When the shortcut is released, the graph returns to its previous control mode.

Name	Tool	Description	Keyboard Shortcut
Pan	S''	Click the tool, then drag inside the graph to pan in any direction (left, right, up, down). Real-time graph update is paused (play button pops up) but the cache continues to update in the background.	Spacebar
Zoom In	÷.	Click the tool, then click in an area of the graph to enlarge that area. Or drag a selection box over a part of the graph you want to see in greater detail.	Ctrl + Spacebar
Zoom Out	Q	Click the tool, then click in the graph and the graph zooms out on that area.	Ctrl + Alt + Spacebar
Cursor		Click to cancel the Pan or Zoom tool.	Release shortcut key(s)
Series Select	X	With the Data panel displayed, click the tool, then slide it left or right over the traces. The Data panel table scrolls to the selected record.	None
Fit Graph	×	After panning or zooming, this tool restores the default range settings for the axes.	Ctrl + 0 (zero)
Configure	- And - Carlor	Format and create templates for graphs.	None
Printing		Print graph.	None

You can expand or compress the graph by clicking and dragging anywhere in the X axis on the bottom of the graph. The real-time graph update is paused but the cache continues to update in the background.

Calibration

Calibrate Sensors

1. Ensure that the instrument is connected to the software, and select the Sensors tab.



- 2. Select the sensor you want to calibrate to activate the Calibration button.
- 3. Click the **Calibration** button.
- 4. Perform the steps in the calibration wizard.

Calibrating the Conductivity Sensor

The conductivity sensor is calibrated with NIST[®]-traceable standards at the factory, which provides a high degree of linearity across the entire operating range. This sensor is capable of meeting its published specifications without requiring additional calibration by the user. Most commercially available standards can introduce a larger potential measurement error than the sensor's initial factory calibration.

User calibration is recommended only if you must conform to a standard operating procedure or if the conductivity cell has undergone physical change (e.g., deposits on conductivity cell walls that cannot be removed or physical damage to the conductivity cell walls).

1. Prepare the instrument for calibration.



There should be no bubbles on the sensor face. Bubbles cause inaccurate calibrations.

- 2. Connect the instrument to the computer.
- 3. Connect the instrument to the software.
- 4. Go to the **Sensors** tab and select the conductivity sensor.

Win-Situ®	5 v Tools Preferences				_ 🗆 ×
	V Tools Preferences	нер	and the second s		
Aqua I	FROLL ® 400	S/N 30	•	si in the second se	/28/2012 09:08 AM 10:09:15 AM
Senso	r	Serial Number	Factory Cal Date	Next Factory Cal Date	Last User Cal Date Nex
	l Dissolved Oxygen	306477	3/2/2012 12:09:52 PM	3/2/2013 6:09:52 PM	8/27/2012 2:56:44 PM
Condu	ıctivity	306593	2/16/2012 10:55:30 AM	2/15/2013 4:55:30 PM	
Pressu	ire/Temp PSIA (90	303526	1/15/2012 9:49:27 PM	1/14/2013 9:49:27 PM	
Analog	pH/ORP	013265	2/21/2012 4:02:59 AM	2/20/2013 4:02:59 AM	
Ŭ					
•					
T)		Ø.In-	Situ Inc.

Ø

5. Click the Calibrate button

If you want to restore the factory calibration, select the check box and click the **right arrow** button.

6. Select either **20° C** or **25° C** as the reference temperature, as indicated by the reference calibration solution.

Conductivity Calibration - Select Method	×
	Restore factory calibration
-	⊂ Specific Conductivity Reference Temp C 20° C C 25° C
And and a second	Select Calibration Standard Calibration Solution: 1413 µS/cm @25C ▼ Enter Value (µS/cm @25° C): Current Readings Temperature (C): 24.5045 Specific Conductivity (µS/cm @25° C): 0

- 7. Select the appropriate calibration standard from the drop-down list. If you select "User Defined," enter the value of the solution.
- 8. Click the **right arrow** button.
- 9. Click **OK** to start the calibration.

Conductivity Calibration - Stabil	lization		×
	Calibration Solution:	1413 µS/cm @25C	
	Specific Conductivity (µS/cm @ 25° C):	1373.13	
	Delta (μS/cm):	-0.0259	
	Current Temperature (C):	24.08	
Zoben	New Cell Constant:	1.029	
ck Cal	Original Cell Constant:	1.085	
Inductively Inductively Inductively	Stability:	Full	
Indust Soutor	7.00 BufferCalibration Duration:	01:25	
Ww.in-situ.com	ingitu.com		
	_		
			\checkmark

Nominal Stability vs. Full Stability

To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.


- 10. When the screen indicates that the calibration has reached stability, click the check mark to complete the calibration, or click **Cancel** to return to the previous calibration.
- 11. You can save or print the calibration report.
- 12. Click **OK** to finish the calibration.
- 13. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.

Calibrating the Pressure Sensor

When a vented instrument is in air (rather than deployed in water) and displays a pressure/level value other than zero, you can calibrate to compensate for electronic drift. If the sensor reading is outside the specified accuracy of the pressure sensor, send the instrument to In-Situ for factory calibration.

Do not calibrate an absolute pressure sensor because this removes barometric pressure (at a single point in time) and causes errors when you post correct the data using a BaroTROLL Instrument.

- 1. Connect the instrument to the computer.
- 2. Connect the instrument to the software.
- 3. Go to the **Sensors** tab and select the sensor.

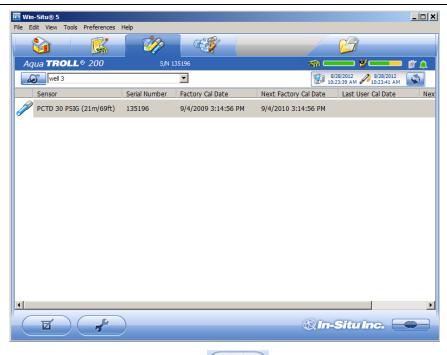

- 4. Click the Calibration button
- 5. Select the pressure parameter from the drop-down list and select Calibrate.

Adjust Reference			×
S	Zero the Level/Pre This operation will Level/Pressure sei exposed to air. Sensor Type:	zero the reading o	
	Current Value:	0.001	PSI
	Adjust Level Refe	rence	
	Use to adjust the not need to be rer New Reference: Current Reference:	level reference val noved from the wa	ue. The device does ter.
_		(X

- 6. Select the Zero the Level/Pressure sensor option.
- 7. Ensure the pressure sensor is dry and exposed to air.
- 8. Click the **check mark**. The pressure reading is reset to zero.

Calibrating the RDO Sensor

You can perform a one-point 100% Oxygen Saturation calibration or a two-point calibration that also includes a 0% Oxygen calibration depending on your application needs.

Calibrate 100% Oxygen Saturation

- 1. Prepare the instrument for 100% Oxygen Saturation calibration.
- 2. Connect the instrument to the computer.
- 3. Connect the instrument to the software.
- 4. Go to the **Sensors** tab and select the RDO Sensor.
- 5. Click the Calibrate button

DO Calibration - Select Method		×
RDO®	Restore factory calibration Select Calibration Standards: D0 value for calibration point 1: D0 value for calibration point 2:	100% saturation 💌
	Current Readings Temperature (C): D0 (mgL): D0 (% saturation): Current Barometric Setting (mbar):	24.7175 6.92875 100.111 849.402
9 0	×	

✓

If you want to restore the factory calibration, select the option and click the **right arrow** button.

- 6. By default, 100% saturation is selected for the first point of the calibration. If you intend to perform a 2-point calibration, also select 0% saturation from the drop-down list. Otherwise, leave as **None**.
- 7. Click the right arrow button.
- 8. Enter the barometric pressure or elevation at which the instrument will be deployed.
- 9. Click the right arrow button.
- 10. Click **OK** to start the calibration.

Nominal Stability vs. Full Stability

To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for



Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.

11. When the screen indicated that the calibration has reached stability, click the **check mark** to complete the calibration, or click **Cancel** to return to the previous calibration.

Calibrate 0% Oxygen Saturation

- 1. If you selected to perform a 2-point calibration, you are prompted to set up the solution for the second point of the calibration.
- 2. Remove the wet sponge from the cup.
- 3. Fill the calibration cup to the fill line with approximately 130 mL of fresh sodium sulfite solution.
- 4. Completely submerge the RDO Sensor into the solution.
- 5. Click **OK**, to start the calibration.
- 6. When the screen indicates that the calibration has reached stability, click the **check mark** to complete the calibration, or click **Cancel** to return to the previous calibration.
- 7. You can save or print the calibration report.
- 8. Click **OK** to complete the calibration.
- 9. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.


Calibrating the pH/ORP Sensor

- 1. Prepare the instrument for calibration.
- 2. Connect the instrument to the computer.
- 3. Connect the instrument to the software.
- 4. Go to the **Sensors** tab and select the pH/ORP sensor.

Edit View	Tools Preferences I	Help			_
		- Ŵ	- C		6
qua Tl	R OLL [®] 400) s/N 3	06593	sh 🗖	¥ #
S			•	8/ 2:4	28/2012 2:48:25 PM
Sensor		Serial Number	Factory Cal Date	Next Factory Cal Date	Last User Cal Date
Optical D	issolved Oxygen	306477	3/2/2012 12:09:52 PM	3/2/2013 6:09:52 PM	8/27/2012 2:56:44 PM
Conducti	ivity	306593	2/16/2012 10:55:30 AM	2/15/2013 4:55:30 PM	
Pressure,	/Temp PSIA (90	303526	1/15/2012 9:49:27 PM	1/14/2013 9:49:27 PM	
🖉 Analog p	H/ORP	013265	2/21/2012 4:02:59 AM	2/20/2013 4:02:59 AM	

Ø

5. Click the Calibrate button



If you want to restore the factory calibration, select the option and click the **right arrow** button.

6. Select Calibrate pH or Calibrate ORP, and click the right arrow button.



- 7. Select the appropriate calibration standard from the drop-down list. If you select **User Defined**, enter the value of the solution.
- 8. Click the right arrow.
- 9. Click **OK** to start the calibration.


Nominal Stability vs. Full Stability

To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.


- 10. When the screen indicates that the calibration has reached stability, click the check mark to complete the calibration, or to continue to the next calibration point. Click **Cancel** to return to the previous calibration.
- 11. You can save or print the calibration report.
- 12. Click **OK** to finish the calibration.
- 13. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.

Calibrating the Turbidity Sensor

1. Prepare the instrument for calibration.



- 2. Connect the instrument to the computer.
- 3. Connect the instrument to the software.
- 4. Go to the **Sensors** tab and select the Turbidity sensor.

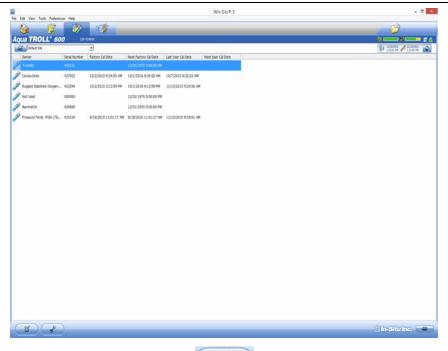

5. Click the Calibrate button



If you want to restore the factory calibration, select the option and click the **right arrow** button.

- 6. Select the appropriate calibration standard from the drop-down list for calibration point 1. If you select **User Defined**, enter the value of the solution.
- 7. Select the appropriate calibration standard from the drop-down list for calibration point 2 if necessary. If you select **User Defined**, enter the value of the solution.
- 8. Click the right arrow.
- 9. Click **OK** to start the calibration.

Nominal Stability vs. Full Stability

To meet the criteria for a valid calibration point, the change in sensor response is monitored over time. The software is looking for the calibration solution temperature and the sensor readings to settle over a specific time period. The criteria for Full Stability are designed to meet the published specifications. The criteria for Nominal Stability are designed to shorten the calibration time when an approximate calibration is acceptable.

- 10. When the screen indicates that the calibration has reached stability, click the check mark to complete the calibration, or to continue to the next calibration point. Click **Cancel** to return to the previous calibration.
- 11. You can save or print the calibration report.
- 12. Click **OK** to finish the calibration.

13. Once calibration is complete, remove the instrument from the calibration cup and rinse both thoroughly with clean water.

Calibration Reports

Saving Calibration Reports

At the end of a successful calibration procedure you are prompted to print and/or save the calibration report.

If you select to save the report, the Windows save file dialog opens and allows you to complete the action.

Viewing Calibration Reports

You can view saved calibration reports on the Data tab or in your working directory.

To find the location of your working directory for Win-Situ 5, go to **Preferences** menu > **Working Directory**.

BaroMerge

Using BaroMerge Software

BaroMerge Software is used to post-correct absolute (non-vented) level sensor data to eliminate barometric pressure effects from the measurements. BaroMerge Software can be accessed through the Win-Situ 5 Software **Tools** menu. BaroMerge provides three options to correct data.

- Fixed Correction—A single offset value is applied to all selected log data. Use this option if you know the barometric pressure of the site during the log, and know that it did not change.
- **Manual Entry**—Specify two or more correction values to apply to the log data. Use this option if you wish to manually enter a data set of barometric pressure values.
- **BaroTROLL log file**—Absolute level sensor data points are individually corrected to reflect barometric pressure changes that were logged by a BaroTROLL instrument during the approximate time period.

🎁 Win-Situ® Baro Merge™	<u>×</u>
	Win-Situ® BaroMerge™
	Select compensation method:
R R	Apply a fixed correction: O PSI
	C Enter one or more values manually.
	C Use a BaroTROLL file:
3 0	

Baro Merge Input—Manual Entry

When you select the **Fixed Correction** and **Manual Entry** options, it is important to know the barometric pressure for the general time period covered by the log or logs you want to correct.

1. From the Tools menu, select Win-Situ BaroMerge.



- 2. Select the Enter one or more values manually option.
- 3. The compensation table appears that allows you to build a table of barometric data that corresponds to the time the log was recorded. The compensation table has

three	preference	options:
	p1010101100	000000

dit Barometri ompensation ta		1	Vin-Situ® Baro Merge™
Date	Time	Value	Select Units: PSI
9/4/2012	12:47:04 PM	850.000	Create New
9/4/2012	12:47:05 PM	854.000	Date 9/ 4/2012
			Time 12:47:06 PM
			Increment 1 Seconds 💌
			Value 854 PSI
			Add
			Save calculated barometric adjustments in new data file(s)
			Show time in UTC
			Ignore daylight saving time (DST)
		1	
Delete	Delete All		Load Save

- The first option, Save calculated barometric adjustments in the new data file(s) is the default option. It adds additional columns depending on which parameters were selected for the absolute/non-vented log in the corrected BaroMerge file that uses the compensation table values. This is intended to show how the adjustments were done in the BaroMerge file. If you do not want to show these adjustments, clear this option.
- When the second option, **Show time in UTC** is selected, the compensation table time stamp displays in Coordinated Universal Time (UTC) time, formally known as Greenwich Mean Time (GMT).
- If the third option, **Ignore daylight saving time (DST)** is selected, the compensation table time stamp format without the daylight savings time adjustment will be shown.
- 3. Build a table that contains at least two barometric pressure values.
- 4. Click the right arrow and select the absolute (non-vented) log file or files you intend to correct.
- 5. Click the check mark and the barometric compensation is applied.
- 6. Compensated data files can be viewed or exported from the Data tab.

Baro Merge Input—Fixed Correction

If you select the **Apply a fixed correction** option, a single correction is applied to all values in the log.

To use this correction method you need barometric pressure values from a reliable source. Choose a single value that represents the actual ambient barometric pressure during the time period the log was recorded. You also need to know the file names of the logs you want to correct.

1. From the Tools menu, select Win-Situ Baro Merge.

📸 Win-Situ® Baro Merge™	<u>×</u>
	Win-Situ [®] BaroMerge [™]
	Select compensation method:
DY A	Apply a fixed correction: O PSI
	C Enter one or more values manually.
	C Use a BaroTROLL file:
3	
	$\bigotimes \bigotimes \checkmark \checkmark$

- 2. Select the Apply a fixed correction option.
- 3. Enter the barometric correction value and select units from the drop-down menu.
- 4. Click the **right arrow** button.
- 5. Select the log files to which the correction will be applied and click the **check mark** button.
- 6. Compensated data files can be viewed or exported from the Data tab.

BaroMerge Input—BaroTROLL File

Log files that contain absolute data can be barometrically compensated using values logged by the In-Situ Inc. BaroTROLL Instrument. Select this method when you have access to a BaroTROLL log file covering approximately the same time period as the data file you intend to correct.

To use this correction method, you need the name of the BaroTROLL log file and the name(s) of the absolute log file(s) you want to correct.

1. From the Tools menu in Win-Situ 5 Software, select Win-Situ BaroMerge.

×
Win-Site Bacologie Control Apply a fixed correction Image: PSI means Image: The one or more values manually. Image: Use a Baro TROLL file Image: Trol Image: T
$\times \bigcirc \bigcirc \bigcirc \checkmark$

- 2. Select the "Use a BaroTROLL file:" option.
- 3. Click the browse button to the right of the file field.
- 4. Select a BaroTROLL file and click the **check mark**.
- 5. Values from the BaroTROLL file will be displayed in the next window. You can edit these values if necessary.
- 6. Click the **right arrow** button.
- 7. Select the log file(s) you intend to correct and click the **check mark**.
- 8. Compensated data files can be viewed or exported from the **Data** tab.

BaroMerge Output

Your original log file is not changed. A new, corrected log file with the same name and path is created. The original ".wsl" extension is replaced by "-Baro Merge.wsl".

Post Level Correction within Baro Merge

It is also possible to post correct a level reference in data collected from an absolute sensor if the data has been compensated through Baro Merge Software.

- 1. Follow the steps to compensate the absolute data for barometric pressure.
- 2. When you reach this screen in the Wizard, you can select the check box to Post

correct files for level.

Win-Situ [®] BaroMerge [™] Select absolute/non-vented files for compensation:
Image: Step Duta Image: Step Duta
F Post correct file(s) for level

Managing Data from Multiple Sites

You can organize and group sites to simplify your data management.

Adding a Site

You can add a new site to the site database in the Win-Situ working directory. After a new site is added, it is available to select as the current site for any instrument.

Editing a Site

You can edit a site to add information that was not available when the site was created, refine a site name (within the 32-character limit), add a site note. If an instrument is connected to the software and it has a running or suspended log, you cannot edit the current site.

- 1. In the **Data** tab, select the **Site** button .
- 2. Edit site information.
- 3. Click **Save** to save the changes.

Deleting a Site

Deleting a site removes it from the site database in your Win-Situ working directory. The site and the data files will be deleted. If the software is connected to an instrument with a running or suspended log the current site cannot be deleted. If while disconnected you inadvertently delete a site that is stored in one of your instruments, Win-Situ will restore it the next time you connect to the instrument.

- 1. In the **Data** tab, expand the **Site Data** folder and right-click the site.
- 2. Select Delete.

Using Site Groups

Site Groups allow you to organize sites, and therefore data, by customer, region, contract, project, etc. For example, if a project for the XYZ corporation has several

different sites where data are logged, you could create a site group called XYZ and drag the appropriate sites into the group on the **Data** tab.

Creating a Site Group

- 1. In the Data tab, select the Site Data folder.
- 2. Click the **File** menu > **New** > **Site Group**.
- 3. Enter a name for the site group. A site group name can have up to 100 characters.
- 4. Click Save.
- 5. The new site group appears in the folder tree with the symbol. The site group does not yet have sites associated with it.
- 6. To place existing sites into your new site group, select one or more sites in the folder tree, drag and drop them under the new group.

Site-Based Connections

Win-Situ allows you to create connection configurations for individual sites. In this way you can easily maintain different communication setups for different sites. The site connection configuration dialog lets you configure and name a connection for the site. When first created, the site connection settings are initialized from the default communication settings (**Preferences** menu > **Comm Settings**).

Creating a Custom Connection

- 1. In the Data tab, select the Connections folder.
- 2. Select File > New > Connection.
- 3. Enter a name for the new connection.
- 4. Select the options you want for the new connection.
- 5. Click Save.

Using a Custom Connection

- 1. Open Win-Situ but do not connect to the instrument.
- 2. Select the custom connection in the folder tree on the Data tab.
- 3. Click the **Connect** button to connect to the instrument using the custom configuration.

Storing Custom Connection for a Site

Once a custom connection has been created, it will appear in the **Connections** area of the **Site Information** screen and can be selected for use with any site.

Correcting a Level Reference in Data Files

About Post Correcting Level Data

In specific cases, it is possible to correct a level reference in a data file after you have stopped the log and downloaded the data. The following criteria must be met in order for a level reference to be post corrected in a data file.


- Data must be compensated for barometric pressure before the level reference can be corrected. Therefore, data must come from a vented instrument, or if it is from an absolute instrument, it must be compensated through Baro Merge Software before the level reference can be corrected.
- The data file must already contain a level mode.
- The data file must have been created with Win-Situ version 5.6.0.0 or higher in order to post correct for the Depth reference type.
- The data must have been downloaded with Win-Situ version 5.6.24.4 or higher.
- If the log was originally set to "Zero at start of test" and the user has made changes to the level reference during logging, it is not possible to correct the data with Win-Situ.

Files that have been corrected are stored in a subdirectory named "Post Corrected Files" and "PostLevelCorrection" is added to the file name. The original data file is not altered.


Open Post Level Correction

Post Level Correction can be accessed through Win-Situ 5 Software or through the Baro Merge Software.

1. To open Post Level Correction in Win-Situ 5 Software go to the menu bar and click **Tools > Post Level Correction**.

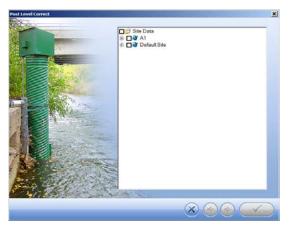

2. The software loads the compatible files. Expand the site that contains the data file you intend to correct and select the file.

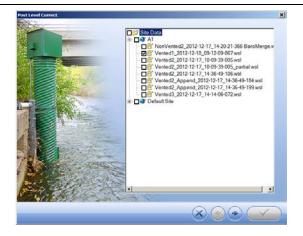

3. Click the **right arrow**.




You can also access **Post Level Correction** in Baro Merge Software. To open **Post Level Correction** within Baro Merge, check the appropriate check box in the Baro Merge Wizard. See page 100.

Select Level Reference Type

In order to post correct the level reference in a data file, the original data must have been collected in level mode.

- 1. You can keep the original level reference type, or you can select one of the following reference types.
 - Pressure head (Depth)
 - Depth to water
 - Elevation or gauge height/stage

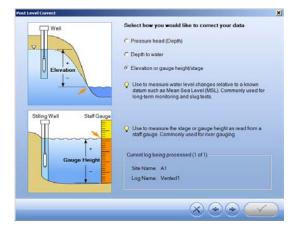

2. Click the right arrow.

Set the Level Correction

- 1. Select **Set level reference (Reference point set at test definition)** if you want to change the level reference at the time you originally set up the log.
- 2. Select **Set level reference (Reference at user selected data point)** if you measured your level reference at any point after the start of the test. You must then select the time from which to apply the correction. The level correction will be applied to all data collected after the selected point.

it Level Correct	Enter corrected level reference for "Elevation or
	gauge height/stage"
1	C Set level reference (Reference set at test definition)
1	Reference set with pressure head. Start of test
	 Set level reference (Specify date/time of manual level reference measurement)
	Time zone: Mountain Daylight Time
	Date: 12/14/2012 Time: 11:45:00 AM
	12/14/2012 11:00:00 AM 12/14/2012 11:15:00 AM
	12/14/2012 11:30:00 AM
	12/14/2012 11:45:00 AM
	New level reference. 12 feet
	Current log being processed (1 of 1)
A.M.	Site name: A1
and a second second	Log name: Vented1
Frank State	Cratic Contraction
A CASES TO CON	and the second s

- 3. Enter the correction value in the Level reference field.
- 4. Click the right arrow button.
- 5. Select a value for specific gravity and click the **right arrow** button.

This step is necessary only if the value for specific gravity was set incorrectly in the original file.


Post Level Correct	x
Post correction complete.	
Click on the check box to end.	
Current log being processed (1 of 1) Sie name: A1 Log name: Vented1	
)

Click the **Correction summary** button to view the changes before you apply them to the file.

6. When post correction is complete, click the **check mark** button.

View Post Level Corrected Data

- 1. To view post corrected level data, go to the Data tab.
- 2. Open the appropriate site in the Site Data folder.
- Files that have been corrected are stored in a subdirectory (on your hard drive) named "Post Corrected Files" and "PostLevelCorrection" is added to the file name. The original data file was not altered.

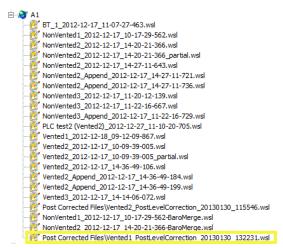

4. You can view the data in Win-Situ 5 or export the data to Excel.

See page 84.

Win-Situ 5 Troubleshooting

Selecting the Correct COM Port

If you are using a USB TROLL Com, select the correct COM port by following the steps below. If you are using a serial TROLL Com, the Win-Situ Software should default to the correct COM port, which is usually COM 1.

Steps for Windows 8.1 and Windows 10 systems.

- 1. Right-click the Start button.
- 2. Click Device Manager.
- 3. Click the arrow next to **Ports (COM and LPT)**, and locate the USB Serial Port listing. The number listed next to this entry is your COM port address.

Steps for Windows 8 systems.

- 1. Right-click the **Start** screen.
- 2. Select All Apps.
- 3. Click Control Panel.
- 4. Open the **Device Manager**.
- 5. Click the arrow next to **Ports (Com and LPT)**, and locate the USB Serial Port listing. The number listed next to this entry is your COM port address.

Steps for Windows 7 systems.

- 1. Click the Start button, and open the Control Panel.
- 2. Click Hardware and Sound, and open the Device Manager.
- 3. Click the arrow next to **Ports (COM and LPT)**, and locate the USB Serial Port listing. The number listed next to this entry is your COM port address.

Steps for Windows XP systems.

- 1. Click the Start button, and open the Control Panel.
- 2. Double-click the **System** icon. Click the **Hardware** tab, and open the **Device Manager**.
- 3. Click the plus sign next to **Ports (COM and LPT)**, and locate the USB Serial Port listing. The number listed next to this entry is your COM port address.



The following steps apply for all Windows operating systems.

- 1. Once you have determined the correct COM port address in your operating system, reopen Win-Situ 5 Software.
- 2. Close any open windows in Win-Situ Software.
- 3. Click Preferences.
- 4. Click **Comm Settings**, and then click the **Port Number** menu.
- 5. Scroll down to find the correct COM port address. Click the **check mark** to accept the changes.
- 6. Click the yellow **Connect** button in the lower right corner to establish a connection to the instrument.

Bluetooth Connection

If you are trying to connect via Bluetooth but cannot establish a connection, try the following:

- Locate your Bluetooth settings and ensure Bluetooth is turned on.
- Ensure your computer is paired with the instrument. In your Bluetooth settings you should see the instrument serial number and "Paired."
- Ensure you have selected the correct COM port in Win-Situ 5 Software.
- Ensure you have clicked the connect button in the bottom right corner of the Win-Situ 5 screen.
- Ensure the communication settings for Win-Situ 5 match the device. See "Connecting with Bluetooth" on page 46.

Water Quality

pН

What is pH?

The term pH is derived from "p" meaning power and "H" for the element hydrogen and literally means "power of hydrogen." pH is defined as the negative logarithm of the hydrogen ion activity (or concentration in moles/liter):

$$pH = -log [H^+] or [H^+] = 10^{-pH}$$

Water (H₂O) dissociates into hydrogen ions (H⁺) and hydroxide ions (OH⁻) in aqueous solution. At 25°C there are 1.0 x 10⁻⁷ moles/L of hydrogen ions and 1.0 x 10⁻⁷ moles/L of hydroxide ions in pure water. Thus the water is nuetral (pH = 7) because there are equal amounts of each ion. Addition of a substance with hydrogen or hydroxide ions will shift the balance and cause the water to become either acidic or basic.

The pH scale ranges from 0 (most acidic) to 14 (most basic or least acidic). A change of 1 pH unit corresponds to a tenfold change in hydrogen ion concentration.

Why Measure pH?

A pH value indicates the amount of hydrogen ion that is present in an aqueous environment. The hydrogen ion concentration gives an indication of the acidity of a substance. pH is an important measurement in natural waters because most chemical and biochemical processes are pH dependent. The physiological chemistry of most living organisms can tolerate only small changes in pH and still provide the chemical reactions to sustain life. The solubility of many chemicals is pH dependent. Thus, pH determines their availability to living organisms.

Typical pH values

Fluid	pH units
Acid rain	<5
Distilled water	5.6
Most nautral waters	8

Fluid	pH units
Safe for freshwater fish	6-9
Properly chlorinated swimming pool	7.2 - 7.6

Natural waters usually have pH values in the range of 4 to 9. Most natural waters are slightly basic (approximately pH 8) because of the presence of carbonates (CO_3^{2-}) and bicarbonates (HCO_3^{-}) . Extremely fresh water can even be slightly acidic (approximately pH 6), depending on the concentration of dissolved carbon dioxide (CO_2) . The carbon dioxide combines with water to form a small amount of carbonic acid (H_2CO_3) and this process lowers the pH. Nitrogen oxides (NO_x) and sulfur dioxides (SO_2) from automobile exhaust and the burning of coal combine with water in the atmosphere to form nitric (HNO_3) and sulfuric acid (H_2SO_4) . This falls to the ground as acid rain and accumulates in surface water. Runoff from mining spoils and the decomposition of plant materials can also cause acidic surface water.

pH values below 5 in natural waters are generally considered to be too acidic for most aquatic organisms. Freshwater fish survive best in the pH range of 6 to 9. Acidic drinking water is a concern due to its corrosive characteristics to plumbing and appliances. pH affects the ammonia/ammonium (NH_3/NH_4^+) equilibrium in water. Even a small ammount of ammonia is detrimental to fish while a moderate ammount of ammonium is tolerated. At a pH of 6.5 almost all ammonia is in the form of ammonium. However, as the pH becomes slightly basic, ammonium is changed into harmful ammonia. The lethal dose of ammonia for trout is only 0.2 mg/L.

The pH/ORP Sensor

The single-junction, three-electrode sensor uses a potentiometric method to measure the pH of a solution. The sensor consists of a pH-sensitive glass whose voltage is proportional to the hydrogen ion concentration. The ORP electrode serves as an electron donor or acceptor depending upon the solution. A second sensor (electrode) serves as a reference, which supplies a constant stable output. Electrical contact is made with the solution using a saturated potassium chloride (KCI) solution. The electrode behavior is described by the Nerst equation:

 $E_{m} = E_{o} + (2.3RT/nF) \log [H^{+}]$

where

 ${\sf E}_m$ is the potential from the pH electrode,

 E_o is related to the potential of the reference electrode,

R is the Gas Law constant,

F is Faraday's constant,

T is the temperature in Kelvin,

n is the ionic charge (+1 for Hydrogen), and

[H⁺] is the hydrogen ion concentration in moles/L.

The instrument reads the signal from the pH electrode, the reference electrode, and the temperature and then calculates the pH using the Nerst equation.

Oxidation-Reduction Potential

What is ORP?

Oxidation-Reduction Potential (ORP) is a measure of a water system's capacity to either release or gain electrons in chemical reactions. The process of oxidation involves losing electrons while reduction involves gaining electrons. Oxidation and reduction (redox) reactions control the behavior of many chemical constituents in drinking water, waste water, and aquatic environments. The reactivity and solubility of critical elements in living systems is strongly dependent on redox conditions. ORP values are used much like pH values to determine water quality. While pH values characterize the relative state of a system for receiving or donating hydrogen ions (acting as a base or an acid), ORP values are affected by all oxidizing and reducing agents, not just acids and bases.

Why Measure ORP?

The effect that potable water has on plumbing is directly related to its ORP value. Unfavorable values can cause excessive corrosion, leading to expensive repairs. ORP is one parameter that can be monitored during the disinfecting process for drinking water, swimming pool water, and spa water.

The life expectancy of bacteria in water is related to ORP. In fact, studies have shown that the life span of bacteria in water is more dependent on the ORP value than on the chlorine concentration. For swimming pools at a normal pH value between 7.2 and 7.6, the ORP value must be kept above 700 mV to kill unwanted organisms. Hypochlorite or other oxidizing agents must be added when the ORP falls below 700 mV. In contrast, natural waters need a much lower ORP value in order to support life.

Fluid	ORP (mV)
Salt water aquarium	~ 350
Harmful to aquatic life	> 400
Properly chlorinated swimming pool	> 700

Typical ORP values

Generally ORP values above 400 mV are harmful to aquatic life. Ideally the ORP value in salt water aquariums should be kept between 350 and 390 mV. ORP levels below 300 mV are to be avoided. An oxidizing environment is needed to convert any ammonia (NH_3) to nitrites (NO_2^{-}) and nitrates (NO_3^{-}) . Ammonia levels as low as 0.002 mg/L can be harmful to some fish species.

The determination of ORP is particularly worthwhile in water that contains a relatively high concentration of a redox-active species, e.g., the salts of many metals (Fe_2^+, Fe_3^+) and strong oxidizing (chlorine) and reducing (sulfite ion) agents. Thus, ORP can sometimes be utilized to track the metallic pollution of ground- or surface water, or to determine the chlorine content of wastewater effluent. However, ORP is a nonspecific measurement—that is, the measured potential is reflective of a combination of the effects of all the dissolved species in the medium. Because of this factor, the measurement of

ORP in relatively clean environmental water (ground, surface, estuarine, and marine) has only limited utility unless a predominant redox-active species is known to be present. Care is required not to "over-interpret" ORP data unless specific information about the site is known.

The pH/ORP Sensor

The single-junction, three-electrode sensor uses a potentiometric method to measure the ORP of a solution. The sensor consists of a pH-sensitive glass whose voltage is proportional to the hydrogen ion concentration. The ORP electrode serves as an electron donor or acceptor depending upon the solution. A second sensor (electrode) serves as a reference, which supplies a constant stable output. Electrical contact is made with the solution using a saturated potassium chloride (KCI) solution. The electrode behavior is described by the Nerst equation:

$$E_m = E_o - (RT/nF) \ln \{[ox] / [red]\}$$

where

 E_m is the potential from the ORP electrode,

 E_o is related to the potential of the reference electrode,

R is the Gas Law constant,

F is Faraday's constant,

T is the temperature in Kelvin,

n is the number of electrons,

[ox] is the oxidant concentration in moles/L, and

[red] is the reduction concentration in moles/L.

Most natural waters contain many species that are involved in the redox process so that it is not possible to calculate the ORP using the Nerst equation. All redox species do however reach equilibrium. A Standard solution of known redox protential for a particular ORP electrode is used to calibrate ORP. The sensor then gives a calibrated response in mV when placed in a sample.

Conductivity

What is Conductivity?

Electrical conductivity measures the ability of a material to carry an electric current. Lakes, rivers, oceans, and underground aquifers are typically good conductors because they contain dissolved salts and minerals. These salts and minerals dissociate in the presence of water to form negatively and positively charged particles called anions and cations. Anions and cations provide provide a pathway for the transportation of electrical chargers throughout the aqueous medium. For the most part, the higher the concentration of dissolved salts and minerals in water, the better the conductor and the higher the electrical conductivity. Deionized/distilled water is a poor conductor because almost all anions and cations are removed during the deionization/distillation process.

Why Measure Conductivity?

Changes in the conductivity of a body of water are often used to indicate an environmental event. For example, a drastic increase in the electrical conductivity of an underground fresh water aquifer located near the ocean could indicate the beginning of salt water intrusion. Contrarily, an increase in the electrical conductivity of a small lake that is completely surrounded by farmland may simply be the result of runoff from a recent rain.

How is Conductivity Measured?

Conductance is the reciprocal of the resistance, in ohms, measured between two opposing electrodes of a 1 cm cube at a specific temperature. The unit 1/ohm or mho was given the name of Siemens (S) for conductance. It is not practical to require all conductance cells to have the dimensions of a exact cube. To enable the comparison of data from experiments with different conductance cells, the conductance is multiplied be the cell constant to give *conductivity* in Siemens per centimeter (S/cm). Cell constants are determined for each sensor using a standard solution of known conductivity. The cell constant depends on the electrode area and the amount of separation or distance between the electrodes.

Fluid	Conductivity Value
Ultra-pure distilled water	0.05 μS/cm
Distilled water	1.0 μS/cm
Drinking water	50 to 300 μS/cm
Surface water	100 to 10,000 μS/cm
Sea water	40,000 to 55,000 μS/cm
Great Salt Lake	158,000 μS/cm

Typical Conductivity values

Early conductivity measurements were performed using cells with two electrodes. This method required using three conductivity cells with different cell constraints in order to span the range of 1 to 100,000 microSiemens per centimeter (μ S/cm). Another inconvenience occured when deposits formed on electrodes, thus reducing the measured conductivity of the sample.

The modern four-electrode conductivity cell offers many advantages over the twoelectrode method. It contains two drive electrodes and two sensing electrodes. The sensing electrodes are positioned in a low current area so that electrode fouling is minimized. An alternating current is used to drive the cell. This reduces errors caused by polarization resulting from the application of direct current.

Dissolved Oxygen

What is Dissolved Oxygen?

The amount of dissolved oxygen (DO) in both natural water and wastewater is a function of several parameters. DO is highly dependent on temperature and atmospheric pressure. An increase in temperature causes a decrease in the amount of oxygen that can dissolve in water. Conversely, higher atmospheric pressures result in higher DO values. Salinity is also a factor. Oxygen solubility is greater in freshwater than in salt water. There are also chemical and biochemical processes that affect DO.

Most of the dissolved oxygen in water comes from the atmosphere, but oxygen from the photosynthesis of aquatic plants is also a key source. DO levels in lakes and other surface water will actually follow a cyclic or diurnal pattern over the course of a day, rising and falling as light intensity changes from dawn to dusk.

Why Measure DO?

Most aquatic life requires an average DO value greater than 5.0 milligrams dissolved oxygen per liter of water (mg/L) in order to survive. Although the amount of dissolved oxygen in a body of water fluctuates due to natural processes, large deviations from normal levels are usually a result of human activity. Changes in DO levels are usually the result of a buildup in organic waste. Organic waste can enter surface water from treatment facilities, runoff from agricultural feed lots or domestic areas, and from industrial discharge. Organic wastes often contain nitrates and phosphates. Nitrates and phosphates are nutrients for aquatic plants and algae, stimulating overproduction when present in excessive levels. Accelerated growth of blooms increase the number of photosynthesizing plants, which temporarily increases the amount of dissolved oxygen. However submerged aquatic vegetation eventually experience a reduction in sunlight die to increased coverage on the surface. This decrease in sunlight leads to a reduction in photosynthesis and eventual death. Bacterial processes take over and consume even more dissolved oxygen. Fish and other aquatic species die due to lack of dissolved oxygen. This tragic process is know as eutrophication.

Conditions	DO Value
100% DO, 0°C, 1 atm, 0 ppm Chlorine*	14.6 mg/L
100% DO, 20°C, 1 atm, 0 ppm Chlorine	9.09 mg/L
100% DO, 0°C, 0.75 atm, 0 ppm Chlorine	6.77 mg/L
100% DO, 20°C, 1 atm, 20 ppm Chlorine	7.35 mg/L
Safe level for most aquatic life	> 5.0 mg/L

Typical DO values

How is DO Measured?

Traditional methods for DO determination include the Winkler titration method and electrochemical methods, such as polarographic (Clark cell) and galvanic probes. With

electrochemical methods, molecular oxygen is consumed by an electrochemical process. Two dissimilar metal electrodes (anode and cathode) are in contact with an electrolyte solution. A semi-permeable membrane separates the electrodes from the sample. As oxygen molecules diffuse through the semipermeable membrane, they are reduced at the cathode to form positively charged ions. The ions migrate to the anode where an oxidation reaction occurs. The oxidation/reduction reaction generates an electrical current that is directly proportional to the oxygen concentration.

Optical sensor technology takes a different approach to quantifying DO. Originally introduced in the 1970s, recent developments have allowed for the production of costeffective probes that operate in demanding environments. The RDO optical dissolved oxygen sensor measures dissolved oxygen using the principle of "dynamic luminescence quenching." Certain molecules, called "lumiphores," floresce when excited by light of a specific wavelength. Oxygen molecules act to quench this florescence. The lumiphores in the sensor are embedded in a gas-permeable sensing foil in a replaceable cap.

The sensor optics include a lens, blue LED and filter, red LED and filter, and a photodetector. When the blue LED emits light, the sensing foil emits red photons; the presence of oxygen in the foil causes a reduction in red light detected by the photodiode. The phase difference between the blue excitation light and the returned red light is measured, and the result is used to compute dissolved oxygen.

This method measures the phase shift (or delay) of the returned signal, and is thus based on the "lifetime" rather than the "intensity" of the luminescence.

Turbidity

What is Turbidity?

Turbidity is an indirect measure of the clarity or transparency of water, and thus is an important indicator of its condition and productivity. Created by suspended matter and microscopic organisms, turbidity causes light to be scattered and absorbed rather than transmitted directly through water. Turbidity is the physical characteristic of the solution that causes light scattering. Turbidity is the opposite of clarity.

The American Public Health Association (APHA) reference word *Standard Methods* (Eaton and others, 2005) defines turbidity as "an expression of the optical property that causes light to be scattered and absorbed rather than transmitted with no change in direction or flux level through the sample."

Turbidity is not:

- a direct measure of clarity.
- a measure of color.
- a measure of suspended solids; it is a measure of their light scattering abilities.

Why Measure Turbidity?

Turbidity measurements :

- can provide a reasonable estimate of the total suspended solids or sediments (TSS) concentration in water.
- can tell us something about the health of a natural water body. Clear water lets light penetrate more deeply int a lake or stream than does murky water. This light allows photosynthesis to occur and oxygen to be produced.
- can be a useful indicator of runoff into surface water systems.
- in flow-cell or in-line applications, when pumping water at very low rates, can provide a good indication of true formation water.

Fluid	Turbidity Value
EPA drinking water	0.3 to 0.5 NTU
Treated water	0 to 1 NTU
Fresh water, >21.5 in. visibility	< 10 NTU
Fresh water, 2.5 in. visibility	240 NTU
Short-term stress to aquatic life	> 10 NTU
Unsafe level for most aquatic life	>100 NTU

Typical Turbidity values

Higher turbidity levels can make it more costly to treat surface water for use as drinking water. Controlling turbidity may be an effective way to protect against pathogens in drinking water.

Aesthetic considerations also play a role in our desire to quantify turbidity: Most people would rather look at, drink, or swim in clear water than in water that appears cloudy, and closely associate appearance with the health of the body of water.

How is Turbidity Measured?

Historical methods for measuring turbidity relied on subjective estimates that depended largely on the eye of the beholder.

In the Jackson Candle method, for example, a candle flame is observed through the length of a glass tube into which a fluid sample is poured until the rays of transmitted and scattered light appear equal and the flame essentially disappears. Among several drawbacks to this method, the reproducibility of standards formulated from natural sediments was diffcult to control.

The Secchi diskk method used in limnological studies involves submerging a weighted, black-and-white painted metal plate until the pattern can no longer be detected. The plate is then pulled up until it is visible again. The average of the two depths provides an estimate of water clarity or transparency.

Modern turbidimeters measure the loss in intensity of a beam or a light beam as it passes through a solution containing suspended and dissolved particles that are large enough to scatter the light. The method is based upon a comparison of the intensity of

light scattered by the sample with the intensity of light scattered by a standard reference suspension. The *nephelometer* is a particular type of turbidimeter that measures the intensity of light scattered at right angles (90°) to the incident light. This lessens the difficulty of differentiating small changes against a large background. Standards for turbididty-measurement instruments specifiy the light source, angle, wavelength, beam width, and sample suspensions, among other factors. Many of today's commonly accepted procedures (e.g., Standard Methods, EPA, and ISO) apply to laboratory bench-top instruments.

Care and Maintenance

Maintenance Schedule

For best results, send the instrument to the manufacturer for factory calibration every 12 to 18 months.

User-Serviceable Parts

The user-serviceable parts on the instrument include the O-rings, the RDO, pH/ORP, conductivity, temperature, and turbidity sensors, and the RDO Sensor Cap.

O-rings

The instrument has several O-rings that can be maintained by the user in order to keep moisture from entering the instrument and damaging the electronics. Apply a very thin layer of vacuum grease to new O-rings upon installation. Check O-rings for cracks, chips, or discoloration and change when any of these conditions appear.

pH/ORP Sensor Replacement

To replace the pH/ORP sensor or to refill the reference junction, follow the instructions in the pH/ORP Sensor Instruction Sheet that is included with the replacement sensor.

RDO Sensor Cap Replacement

The RDO Sensor Cap has a 2-year typical life. Follow the instructions included in the RDO Sensor Cap Replacement Kit. Replacement caps are available from In-Situ Inc. or your authorized In-Situ distributor.

Instrument Storage

Short-term Storage (<1 Week)

The restrictor can be used as a storage cup.

- 1. Remove the restrictor from the sonde body.
- 2. Remove the blue end cap from the restrictor.
- 3. Screw the blue end cap on to the restrictor end opposite of the flow-through holes.
- 4. Pour 15 mL (5 oz) of clean water into the restrictor.
- 5. Screw the restrictor on to the sonde.

Long-term Storage (>1 Week)

- 1. Remove the pH/ORP sensor and place a sensor port plug into the empty pH/ORP port.
- 2. Add a small amount of pH Storage Solution (0065370) or pH 7 calibration solution (0083210) to the sponge in the pH/ORP storage cap.

3. Place the cap firmly on the sensor. Use electrical tape to seal the cap to the sensor.



Electrical tape prevents the sponge from drying out and keeps crystals from forming on the sensor body.

- 4. Place a dust cap on the sensor connector.
- 5. Remove the batteries from the sonde.
- 6. Remove the restrictor from the sonde body.
- 7. Remove the blue end cap from the restrictor.
- 8. Screw the blue end cap on to the restrictor end opposite of the flow-through holes.
- 9. Screw the restrictor on to the sonde.
- 10. Place a dust cap on the sensor connector.
- 11. Store the sonde and pH/ORP sensor in the box they arrived, at temperatures between -5° to 65° C.

Cleaning the Sonde

Rinse the sonde thoroughly, clean with warm water and mild soap, then rinse the sonde again. Allow to air dry.

1

Prevent water from entering the cable connector.

Cleaning and Storing the pH/ORP Sensor

Routine Maintenance

If the ORP platinum electrode is dull or dirty, it can be cleaned with a swab and methanol or isopropyl alcohol. Rub the electrode gently until it is shiny.

The pH sensor must be kept moist for the life of the sensor.

The sensor fill solution has a shelf life of 2 years. Replace the fill solution every 5 to 6 months or when:

- The sensor fails to calibrate within the acceptable slope and offset range.
- Sensor readings vary.
- Readings during calibration at pH 7 are greater than +30 mV or less than -30 mV.
- Sensor is slow to respond.

If the sensor fails to calibrate after you replace the fill solution, replace the reference junction.

Replacing the Filling Solution

- 1. Remove the sensor from the port.
 - Aqua TROLL 600–Loosen the screw at the bottom of the sensor. Insert the tool into the small hole and lever the sensor out of the sonde.
- 2. Install the dust cap on the connector end or wrap the connector end in a paper towel to prevent solution from entering the connector.
- 3. Unscrew the reference junction.
- 4. Hold the sensor at an angle and shake out the old filling solution.
- 5. Using the dispenser cap on the filling solution bottle, insert the tube into the bottom of the empty reservoir. Squeeze a steady stream of solution into the reservoir until it overflows and no bubbles are observed. Continue to add solution while pulling the tube out of the reservoir.
- 6. Attach the reference junction to the sensor and hand-tighten until firmly attached. Some filling solution will overflow. Wipe the excess off the sensor body.
- 7. Soak the sensor in tap water for at least 15 minutes.
- 8. Calibrate the sensor.



If necessary, thoroughly clean the sensor connector to remove filling solution: Using a disposable pipette, fill the connector with isopropyl alcohol (70% to 100%), Shake to dry. Repeat 3 times. Dry overnight. When thoroughly dry, calibrate the sensor.

Replacing the Junction

Replace the junction when the sensor fails to calibrate with a reasonable slope and offset, even after you have replaced the filling solution.

- 1. Unscrew the reference junction and discard.
- 2. Replace the filling solution and screw in a new reference solution.
- 3. Soak for 15 minutes, then calibrate the sensor.



Keep the junction damp at all times to avoid a lengthy rewetting process.

Cleaning

Begin with the most gentle cleaning method and continue to the other methods only if necessary. Do not directly wipe the glass bulb.

To clean the pH sensor, gently rinse with cold water. If further cleaning is required, consider the nature of the debris.

To remove crystalline deposits:

- Clean the sensor with warm water and mild soap.
- Soak the sensor in 5% HCl solution for 10 to 30 minutes.
- If deposits persist, alternate soaking in 5% HCI and 5% NaOH solutions.

To remove oily or greasy residue:

- Clean the sensor with warm water and mild soap.
- Methanol or isopropyl alcohol may be used for short soaking periods, up to 1 hour.
- Do not soak the sensor in strong solvents, such as chlorinated solvents, ethers, or ketones, such as acetone.

To remove protein-like material, or slimy film:

- Clean the sensor with warm water and mild soap.
- Soak the sensor in 0.1 M HCI solution for 10 minutes and then rinse with deionized water.

After performing any of these cleaning methods, rinse the sensor with water, then soak overnight in pH 4 buffer.

Short-term Storage

Up to 1 week: Soak the sponge included with the black storage cap with pH 4 buffer and install the cap on to the sensor. Use electrical tape to seal the cap onto the sensor to prevent leaks or the sponge drying out.



Long-term Storage

Greater than 1 week: Soak the sponge included with the black storage cap with storage solution (0065370) and install the cap on to the sensor. Use electrical tape to seal the cap onto the sensor to prevent leaks or the sponge drying out.

Storage Recommendations

Prior to using the pH sensor after long-term storage, rinse the sensor with DI water and then soak it in pH 4 buffer for 1 or 2 hours. This will saturate the glass bulb with hydrogen ions and prepare it for use.



Do not store the pH sensor in DI water because it will deplete the reference solution and drastically reduce the life of the sensor.

Cleaning and Storing the RDO Sensor

Routine Maintenance

- 1. Leave the sensor cap on.
- 2. Rinse the sensor with clean water.
- 3. Gently wipe with a soft cloth or brush if biofouling is present.
- 4. If extensive fouling or mineral buildup is present, soak the sensor in vinegar for 15 minutes, then soak in deionized water for 15 minutes.



Do not use organic solvents—they will damage the sensor cap. Do not remove the sensor cap when rinsing or brushing.

5. After cleaning the sensor, perform a 2-point calibration.

Cleaning the Optical Window

Clean the optical window only when changing the sensor cap.

- 1. Remove the cap.
- 2. Gently wipe the sensing window with the supplied lens cloth.



Do not wet the lens with any liquid.

Storage

Prior to installation, store the sensor body and cap in the factory supplied containers.

Once installed on the sonde, the RDO sensor can be stored wet or dry depending on the sensor configuration of the sonde.

Never store the RDO sensor without the sensor cap once it has been installed on the sonde.

Cleaning and Storing the Conductivity Sensor

Cleaning

Begin with the most gentle cleaning method and continue to the other methods only if necessary.

To clean the conductivity sensor face, gently rinse with clean, cold water. If further cleaning is required, consider the nature of the debris.

To remove crystalline deposits:

- Clean the sensor face with warm water and mild soap.
- Use a soft brush to gently clean the sensor pins and temperature button. Ensure removal of all debris around the base of the pins and button.
- If crystalline deposits persist, soak in 5% HCl for 10 to 30 minutes followed by warm soapy water and soft brushing.
- If deposits persist, alternate soaking in 5% HCl and 5% NaOH solutions followed by warm soapy water and soft brushing.

To remove oily or greasy residue:

- Clean the sensor face with warm water and mild soap.
- Using a soft brush, gently clean the sensor pins and temperature button. Ensure removal of all residue around the base of the pins and temperature button.
- Isopropyl alcohol may be used for short soaking periods, up to one hour.
- Do not soak in strong solvents such as chlorinated solvents, ethers or ketones (such as acetone).

To remove protein-like material, or slimy film:

- Clean the sensor face with warm water and mild soap.
- Using a soft brush, gently clean the sensor pins and temperature button. Ensure removal of all material/film around the base of the pins and temperature button.
- Soak the sensor in 0.10% HCl for 10 minutes and then rinse thoroughly with distilled water.

Storage

Prior to installation, store the sensor in the factory supplied container.

Once installed on the sonde, the conductivity sensor can be stored wet or dry depending on the sensor configuration of the sonde.

Cleaning and Storing the Turbidity Sensor

Routine Maintenance

The optical windows should be clear of foreign material. To clear material gently rub the sensing windows using clean water and a soft cloth or swab. Do not use solvents on the sensor.

Storage

Prior to installation, store the sensor in the factory supplied container.

Once installed on the sonde, the turbidity sensor can be stored wet or dry depending on the sensor configuration of the sonde.

Replacing Wiper Bristles

Wiper bristles need to be replaced based on site conditions. In-Situ recommends replacing bristles at least every 12 months or when visibly bent, damaged, or fouled.



Replace the Bristles

- 1. Loosen the set screw near the base of the wiper head.
- 2. Slide the wiper head off the wiper shaft.
- 3. Slide both bristle sets out of the wiper head.
- 4. Insert new small bristle set into the small slot and the large bristle set in the large slot.
- 5. Slide the wipe head on to the wiper shaft, and position the wiper head so the set screw faces the flat part of the wiper shaft.
- 6. Tighten the set screw near the base of the wiper head.

Replace the Entire Brush

- 1. Loosen the set screw near the base of the wiper head.
- 2. Slide the wiper head off the wiper shaft.
- 3. Slide the wipe head on to the wiper shaft, and position the wiper head so the set screw faces the flat part of the wiper shaft.



4. Tighten the set screw near the base of the wiper head.

Cleaning the Copper Antifouling Restrictor

When copper is deployed in environmental waters, particularly marine environments, the copper will oxidize and its biocidal properties decrease. Cleaning the copper restores the effectiveness of the restrictor's antifouling capability.

- 1. Remove the restrictor from the sonde.
- 2. Remove the restrictor end cap.
- 3. Submerge the restrictor in white vinegar (acetic acid) for 24 hours.
- 4. Rinse the restrictor in water and air dry.

Declaration of Conformity

Manufacturer:	In-Situ, Inc.
	221 East Lincoln Avenue
	Fort Collins, CO 80524
	USA

Declares that the following product:

Product name:	Aqua TROLL [®] 600 Multiparameter Sonde
Model:	Aqua TROLL [®] 600
Product Description:	Multiparameter water quality data logger

is in compliance with the following Directive

2004/108/EC for Electromagnetic Compatibility (EMC) Directive

and meets or exceeds the following international requirements and compliance standards:

Immunity

EN 61326, Electrical Equipment for Measurement, Control and Laboratory Use, Industrial Location

Emissions
 Class A requirements of EN 61326, Electrical Equipment for Measurement,
 Control and Laboratory Use

Supplementary Information:

The device complies with the requirements of the EU Directives 2004/108/EC and 2006/95/EC, and the CE mark is affixed accordingly.

Ben PK-

Ben Kimbell VP of R&D In-Situ, Inc. August 25, 2015

RoHS (EFC

FCC (SSSBC127-X)